

AD-A105 011


PRC CONSOER TOWNSEND INC ST LOUIS MO  
NATIONAL DAM SAFETY PROGRAM. WOODRIDGE LAKE DAM (MO 11005), MIS--ETC(U)  
SEP 79 W G SHIFRIN  
DACW43-79-C-0075

F/G 13/13

UNCLASSIFIED

NL

1 of 2  
AD-A  
105011

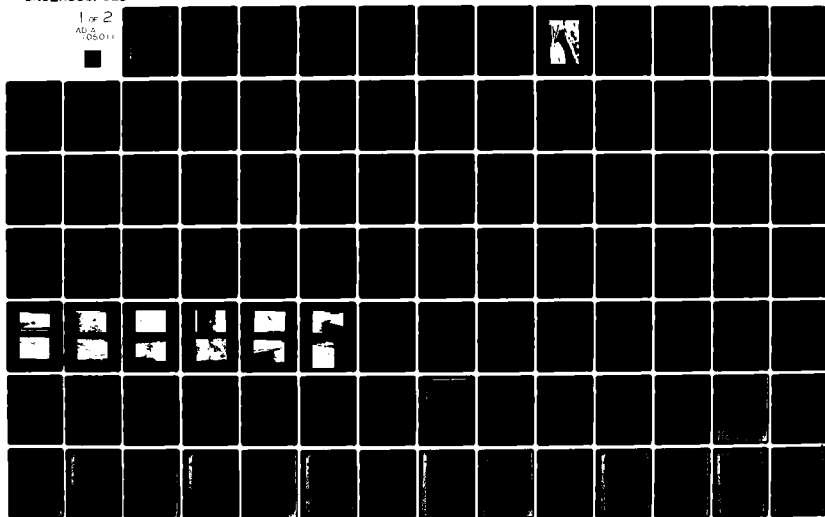

# MISSISSIPPI-KASKASKIA-ST. LOUIS BASIN

AD A105011

**EVEL**

①

WOODRIDGE LAKE DAM

WARREN COUNTY, MISSOURI

MO 11005

(9) Final rept.,

DACW43-79-C-0075

(11) Sep 79

(10) Walter G. /Shifrin

## PHASE I INSPECTION REPORT NATIONAL DAM SAFETY PROGRAM

Woodridge Lake Dam (MO 11005)  
Mississippi - Kaskaskia - St. Louis Basin  
Warren County, Missouri. Phase I Inspection  
Report.

**DTIC**  
**ELECTE**  
**S** OCT 0 6 1981 **D**  
**E**



United States Army  
Corps of Engineers

Serving the Army  
Serving the Nation

**St. Louis District**

PREPARED BY: U. S. ARMY ENGINEER DISTRICT, ST. LOUIS

FOR: STATE OF MISSOURI

This document has been approved  
for public release and sale; its  
distribution is unlimited.

SEPTEMBER, 1979

81 10 2 144

FILE COPY

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

| REPORT DOCUMENTATION PAGE                                                                                                                                                                                                                                                                                                                                                    |                       | READ INSTRUCTIONS<br>BEFORE COMPLETING FORM                    |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------|----------------------------------------------------------------|
| 1. REPORT NUMBER                                                                                                                                                                                                                                                                                                                                                             | 2. GOVT ACCESSION NO. | 3. RECIPIENT'S CATALOG NUMBER                                  |
|                                                                                                                                                                                                                                                                                                                                                                              | AD-A105 011           |                                                                |
| 4. TITLE (and Subtitle)<br>Phase I Dam Inspection Report<br>National Dam Safety Program<br>Woodridge Lake Dam (MO 11005)<br>Warren County, Missouri                                                                                                                                                                                                                          |                       | 5. TYPE OF REPORT & PERIOD COVERED<br>Final Report             |
| 7. AUTHOR(s)<br>Consoer, Townsend and Associates, Ltd.                                                                                                                                                                                                                                                                                                                       |                       | 6. PERFORMING ORG. REPORT NUMBER                               |
| 9. PERFORMING ORGANIZATION NAME AND ADDRESS<br>U.S. Army Engineer District, St. Louis<br>Dam Inventory and Inspection Section, LMSED-PD<br>210 Tucker Blvd., North, St. Louis, Mo. 63101                                                                                                                                                                                     |                       | 8. CONTRACT OR GRANT NUMBER(s)<br><br>DACW43-79-C-0075         |
| 11. CONTROLLING OFFICE NAME AND ADDRESS<br>U.S. Army Engineer District, St. Louis<br>Dam Inventory and Inspection Section, LMSED-PD<br>210 Tucker Blvd., North, St. Louis, Mo. 63101                                                                                                                                                                                         |                       | 10. PROGRAM ELEMENT, PROJECT, TASK<br>AREA & WORK UNIT NUMBERS |
| 14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)                                                                                                                                                                                                                                                                                                  |                       | 12. REPORT DATE<br>September 1979                              |
|                                                                                                                                                                                                                                                                                                                                                                              |                       | 13. NUMBER OF PAGES<br>Approximately 80                        |
|                                                                                                                                                                                                                                                                                                                                                                              |                       | 15. SECURITY CLASS. (of this report)<br><br>UNCLASSIFIED       |
|                                                                                                                                                                                                                                                                                                                                                                              |                       | 15a. DECLASSIFICATION/DOWNGRADING<br>SCHEDULE                  |
| 16. DISTRIBUTION STATEMENT (of this Report)<br><br>Approved for release; distribution unlimited.                                                                                                                                                                                                                                                                             |                       |                                                                |
| 17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)                                                                                                                                                                                                                                                                                   |                       |                                                                |
| 18. SUPPLEMENTARY NOTES                                                                                                                                                                                                                                                                                                                                                      |                       |                                                                |
| 19. KEY WORDS (Continue on reverse side if necessary and identify by block number)<br><br>Dam Safety, Lake, Dam Inspection, Private Dams                                                                                                                                                                                                                                     |                       |                                                                |
| 20. ABSTRACT (Continue on reverse side if necessary and identify by block number)<br>This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property. |                       |                                                                |

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)



DEPARTMENT OF THE ARMY  
ST. LOUIS DISTRICT, CORPS OF ENGINEERS  
210 NORTH 12TH STREET  
ST. LOUIS, MISSOURI 63101

IN REPLY REFER TO

SUBJECT: Woodridge Lake Dam (Mo. 11005) Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Woodridge Lake Dam (Mo. 11005).

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria:

- 1) Spillway will not pass 50 percent of the Probable Maximum Flood
- 2) Overtopping could result in dam failure
- 3) Dam failure significantly increases the hazard to loss of life downstream

SUBMITTED BY:

Chief, Engineering Division

Date

APPROVED BY:

Colonel, CE, District Engineer

Date

|                    |                                            |
|--------------------|--------------------------------------------|
| Accession For      |                                            |
| NTIS GRA&I         | <input checked="checked" type="checkbox"/> |
| DTIC TAB           | <input type="checkbox"/>                   |
| Unannounced        | <input type="checkbox"/>                   |
| Justification      |                                            |
| By                 |                                            |
| Distribution/      |                                            |
| Availability Codes |                                            |
| Dist               | Avail and/or<br>Special                    |
| A                  |                                            |

WOODRIDGE LAKE DAM  
WARREN COUNTY, MISSOURI

MISSOURI INVENTORY NO. 11005

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

PREPARED BY  
CONSOER, TOWNSEND AND ASSOCIATES LTD.  
ST. LOUIS, MISSOURI  
AND  
ENGINEERING CONSULTANTS, INC.  
ENGLEWOOD, COLORADO  
A JOINT VENTURE

UNDER DIRECTION OF  
ST. LOUIS DISTRICT, CORPS OF ENGINEERS  
FOR  
GOVERNOR OF MISSOURI

SEPTEMBER 1979

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

Name of Dam: Woodridge Lake Dam, Missouri Inv. No. 11005  
State Located: Missouri  
County Located: Warren  
Stream: Unnamed Tributary of Dry Fork  
Date of Inspection: May 16, 1979

Assessment of General Condition

Woodridge Lake Dam was inspected by the engineering firms of Consoer, Townsend, and Associates Ltd. of St. Louis, Missouri and Engineering Consultants, Inc. (a joint venture) using the "Recommended Guidelines for Safety Inspection of Dams". These guidelines were developed by the Chief of Engineers, U.S. Army, Washington, D.C., with the help of Federal and state agencies, professional engineering organizations, and private engineers. The resulting guidelines are considered to represent a consensus of the engineering profession.

Based on the criteria in the guidelines, the dam is in the high hazard potential classification, which means that loss of life and appreciable property loss could occur in the event of failure of the dam. The estimated damage zone extends approximately 5-1/2 miles downstream of the dam. Within this zone are eleven dwellings and seven outbuildings which may be subjected to flooding, with possible damage and/or destruction, and possible

loss of life. Woodridge Lake Dam is in the intermediate size classification since it is more than 40 feet high, but less than 100 feet high.


Our inspection and evaluation indicates that the spillway of Woodridge Lake Dam does not meet the criteria set forth in the guidelines for a dam having the above size and hazard potential. Woodridge Lake Dam is a intermediate size dam with a high hazard potential required by the guidelines to pass from one-half of the Probable Maximum Flood to the Probable Maximum Flood without overtopping. Since there is high hazard potential downstream of the dam, the appropriate spillway design flood for this dam is the Probable Maximum Flood. It was determined that the reservoir/spillway system can accomodate 27 percent of the Probable Maximum Flood without overtopping the dam. Our evaluation indicates that the reservoir/spillway system will accomodate the 100-year flood; that is, a flood having a 1 percent chance of being equalled or exceeded during any given year.

The Probable Maximum Flood is defined as the flood discharge that may be expected from the most severe combination of critical meteorological and hydrologic conditions that are reasonably possible in the region.

Other deficiencies noted by the inspection team were the deep erosion gullies along left and right abutments contacts, wave erosion on the upstream embankment slope, undercutting at the discharge end of the service spillway pipe and poorly channelized exit for the emergency spillway discharges. The lack of stability and seepage analysis on record is also a deficiency that should be corrected.

It is recommended that the owner take action to correct or control the deficiencies described above.

*Walter G. Shifrin*  
Walter G. Shifrin, P.E.

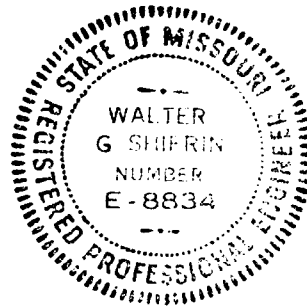



Overview of Woodridge Lake Dam

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

WOODRIDGE LAKE, I.D. No. 31140

TABLE OF CONTENTS

| <u>Sect. No.</u> | <u>Title</u>                         | <u>Page</u> |
|------------------|--------------------------------------|-------------|
| SECTION 1        | PROJECT INFORMATION . . . . .        | 1           |
|                  | 1.1 General . . . . .                | 1           |
|                  | 1.2 Description of Project . . . . . | 3           |
|                  | 1.3 Pertinent Data . . . . .         | 8           |
| SECTION 2        | ENGINEERING DATA . . . . .           | 11          |
|                  | 2.1 Design . . . . .                 | 11          |
|                  | 2.2 Construction . . . . .           | 11          |
|                  | 2.3 Operation . . . . .              | 11          |
|                  | 2.4 Evaluation . . . . .             | 12          |
| SECTION 3        | VISUAL INSPECTION . . . . .          | 14          |
|                  | 3.1 Findings . . . . .               | 14          |
|                  | 3.2 Evaluation . . . . .             | 18          |

## TABLE OF CONTENTS

(Continued)

| <u>Sect. No.</u> | <u>Title</u>                                                 | <u>Page</u> |
|------------------|--------------------------------------------------------------|-------------|
| SECTION 4        | OPERATION PROCEDURES . . . . .                               | 20          |
|                  | 4.1 Procedures . . . . .                                     | 20          |
|                  | 4.2 Maintenance of Dam . . . . .                             | 20          |
|                  | 4.3 Maintenance of Operating<br>Facilities . . . . .         | 21          |
|                  | 4.4 Description of Any Warning<br>System in Effect . . . . . | 21          |
|                  | 4.5 Evaluation . . . . .                                     | 21          |
| SECTION 5        | HYDRAULIC/HYDROLOGIC . . . . .                               | 22          |
|                  | 5.1 Evaluation of Features . . . . .                         | 22          |
| SECTION 6        | STRUCTURAL STABILITY . . . . .                               | 26          |
|                  | 6.1 Evaluation of Structural<br>Stability . . . . .          | 26          |
| SECTION 7        | ASSESSMENT/REMEDIAL MEASURES . . . . .                       | 29          |
|                  | 7.1 Dam Assessment . . . . .                                 | 29          |
|                  | 7.2 Remedial Measures . . . . .                              | 31          |

TABLE OF CONTENTS

(Continued)

LIST OF PLATES

|                                     | <u>Plate No.</u> |
|-------------------------------------|------------------|
| LOCATION MAP . . . . .              | 1                |
| PLAN AND ELEVATION OF DAM . . . . . | 2-3              |
| GEOLOGIC MAPS . . . . .             | 5-6              |

APPENDICES

|            |   |                         |
|------------|---|-------------------------|
| APPENDIX A | - | PHOTOGRAPHS             |
| APPENDIX B | - | HYDROLOGIC COMPUTATIONS |

PHASE I INSPECTION REPORT  
NATIONAL DAM SAFETY PROGRAM

WOODRIDGE LAKE DAM, Missouri Inv. No. 11005

SECTION 1: PROJECT INFORMATION

1.1 General

a. Authority

The Dam Inspection Act, Public Law 92-367 of August, 1972, authorizes the Secretary of the Army, through the Corps of Engineers, to initiate a national program of dam inspections. Inspection for Woodridge Lake Dam was carried out under Contract DACW 43-79-C-0075 to the Department of the Army, St. Louis District, Corps of Engineers, by the engineering firms of Consoer, Townsend & Associates Ltd., and Engineering Consultants, Inc. (A Joint Venture), of St. Louis, Missouri.

b. Purpose of Inspection

The visual inspection of Woodridge Lake Dam was made on May 16, 1979. The purpose of the inspection was to make a general assessment as to the structural integrity and operational adequacy of the dam embankment and its appurtenant structures.

c. Scope of Report

This report summarizes available pertinent data relating to the project; presents a summary of visual observations made during the field inspection; presents an assessment of hydrologic and hydraulic conditions at the site; presents an assessment as to the structural adequacy of the various project features; and assesses the general condition of the dam with respect to safety.

Subsurface investigations, laboratory testing, and detailed analyses were not within the scope of this study. The conclusions drawn herein, therefore, are based on the presence of, or absence of, obvious signs of distress. No warranty as to the absolute safety of the project features is implied by the conclusions presented in this report.

It should be noted that reference in this report to left or right abutments is as viewed looking downstream. Where left abutment or left side of the dam is used in this report, this also refers to north abutment or side, and right to the south abutment or side.

d. Evaluation Criteria

Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, in "Recommended Guidelines for Safety Inspection of Dams", Appendix D. These guidelines were developed with the help of several Federal agencies and many state agencies, professional engineering organizations, and private engineers.

## 1.2 Description of the Project

### a. Description of Dam and Appurtenances

Two drawings for Woodridge Lake Dam were obtained. These drawings are given as plates in this report. The drawings do not appear to be as built drawings, and the dimensions and elevations are, therefore, approximate. The description below is based primarily on observations and measurements made during the visual inspection, supplemented by information shown on the drawings.

The dam embankment is a compacted earthfill structure. The drawings show the dam to have a clay core with a top width of 20 feet, and a bottom width of 50 feet. A clay cutoff trench is also shown on the drawings to have been constructed. This cutoff trench is shown to have a bottom width of 20 feet, a height of 5 feet, and side slopes of 1V to 3H.

The crest, which functions as a sand and gravel surfaced roadway is 25 feet wide. The crest length is 485 feet, and the crest elevation is approximately 821.0 feet MSL. The hydraulic height of the embankment is 58.5 feet, and the 5 foot high cutoff trench makes the structural height equal to 63.5 feet.

The downstream slope of the embankment was measured as 1V to 2.75H. The drawings show the upstream slope to be 1V to 3H. One notable difference in slopes is a horizontal berm about seven feet below the crest on the upstream side. This berm could be seen under water. No riprap was placed on the upstream slope. The entire exposed embankment with the exception of the roadway crest and some erosion gullies had a

grass cover. From exposures in erosion gullies the embankment material appears to be mainly residual soils containing much gravel and sand.

The dam is situated on the border between the Dissected Till Plain Section of Central Lowlands Physiographic Province which extends to the north and the Ozark Plateau Province to the south. Although the area in which the dam and reservoir are located was glaciated during Pleistocene time, the till and loess which characterize the uplands of the Till Plains have been largely removed by erosion since the end of the Pleistocene. The area is characterized by wooded hills which have gentle to steep slopes.

The bedrock geology of the area, as shown on the Geologic Map of Missouri (1979), typically consists of gently northeastwardly dipping (ca. 30-50 feet/mile) sediments of Paleozoic age. To the north of Warren County these beds are often capped by young (Pleistocene) deposits of glacial drift and wind blown loess. In southern areas of the county the bedrocks is generally covered by residual soil, colluvium, or alluvium. The rocks underlying the area are predominately carbonates (limestones and dolomites), although beds of sandstone and shale are not infrequent.

The bedrock of Warren County contains some minor folding. The largest known geologic structure in the area is a gentle anticline centered about 2 1/2 miles northwesterly of the town of Warrenton. This fold may have affected the beds at the damsite.

Woodridge Lake Dam contains two spillways. The service spillway is a 36 inch diameter vertical drop inlet steel pipe located 340 feet from the right abutment of the dam. Ten feet from the top of the pipe a 24-inch diameter corrugated metal pipe connects to the steel drop inlet pipe. This corrugated metal pipe was constructed through the embankment to a discharge point at the downstream toe of the dam. A steel anti-vortex plate and a trashrack made of #4 reinforcing bars are located at the intake to the drop inlet pipe. The downstream end of the service spillway discharges into a pool just downstream of the toe of the dam.

The emergency spillway is an open channel located at the left abutment of the dam. The channel crosses the road. The spillway is V-shaped, with a total width at the top 74.0 feet and side slopes of approximately 1V to 22H on the left bank and 1V to 30H on the right bank. The maximum depth of the spillway is 17 inches.

There is no operating outlet pipe or low level drain pipe at the dam.

b. Location

Woodridge Lake Dam is situated on a small intermittent stream about 1000 feet upstream of its confluence with the intermittent Dry Fork. Dry Fork flows about 7 miles in a generally southerly then southeasterly direction to Charette Creek which joins the Missouri River about four miles to the southeast near Marthasville, Missouri. The main access to the dam and lake from Warrenton, Missouri, is south on State Highway No. 47 approximately 2 miles to a small gravel road. The dam and lake is located 1/2 mile west of the State Highway off of the gravel road. The damsite is shown on the Warrenton

Quadrangle Sheet (7.5 minute series) in Section 5, Township 46 North, Range 2 West.

c. Size Classification

According to the "Recommended Guidelines for Safety Inspection of Dams", by the U.S. Department of the Army, Office of the Chief Engineer, the dam is classified in the dam size category as being "Small" since its storage is less than 1,000 acre-feet. The dam is classified as "Intermediate" in dam size category because its height is more than 40 feet, but less than 100 feet. The overall size classification is governed by the larger of the two determinations, and the classification is, accordingly, "Intermediate" in size.

d. Hazard Classification

The dam has been classified as having "High" hazard potential in the National Inventory of Dams, on the basis that in the event of failure of the dam or its appurtenances, excessive damage could occur to downstream property, together with the possibility of the loss of life. The estimated damage zone extends approximately 5-1/2 miles downstream of the dam. Within this zone, eleven dwellings and seven out-buildings may be found.

e. Ownership

Woodridge Lake Dam is owned by Woodridge Trustees. The mailing address is Woodridge Trustees, c/o Mary Grubb, P. O. Box 339, Warrenton, Missouri, 63383.

f. Purpose of Dam

The main purpose of the dam is to impound water for recreational use for landowners adjacent to the dam.

g. Design and Construction History

Woodridge Lake was designed in 1975 by Stolwyk, McDaniel, Ferrenbach of Clayton, Missouri. A limited set of plans has been made available for this report.

The lake was designed for recreational purposes only and is exclusively used by the residents of Woodridge. The contractor for the construction in 1975 was Norvell Construction of 3320 Hermoso St., St. Louis, MO.

After the structure was completed, a 2 inch water-line with a water faucet was installed on the right upstream side near the boat ramp by Don Burgess, a local resident. The faucet was provided for clean-up purposes for the convenience of the local residents. This information was obtained on the day of inspection from a trustee, Mr. Goodson and one of the maintenance personnel, Mr. D. Simpson of Woodridge.

h. Normal Operational Procedures

The dam was built to impound water for recreational use. The lake is privately owned and operated by the residents of Woodridge. The water level is controlled by rainfall, runoff, evaporation and the 36 inch drop inlet pipe. The inspection team is not aware of any operational or water level records for Woodridge Lake.

1.3      Pertinent Data\*

|                                                                         |        |
|-------------------------------------------------------------------------|--------|
| a.    Drainage Area (square miles):                                     | 0.66   |
| b.    Discharge at Damsite                                              |        |
| Estimated experienced maximum flood (cfs):                              | 10     |
| Estimated ungated spillway capacity<br>at maximum pool elevation (cfs): | 203    |
| c.    Elevation    (Feet above MSL)                                     |        |
| Top of dam:                                                             | 821.0  |
| Spillway crest:                                                         |        |
| Service Spillway                                                        | 814.0  |
| Emergency Spillway                                                      | 819.6  |
| Normal Pool                                                             | 814.0  |
| Maximum Pool (PMF):                                                     | 823.14 |
| d.    Reservoir                                                         |        |
| Length of maximum pool:(Feet)                                           | 2745   |
| e.    Storage (Acre-Feet)                                               |        |
| Top of dam:                                                             | 740    |
| Spillway crest:                                                         |        |
| Service Spillway                                                        | 533    |
| Emergency Spillway                                                      | 694    |
| Normal Pool:                                                            | 533    |
| Maximum Pool (PMF):                                                     | 740    |
| f.    Reservoir Surface    (Acres)                                      |        |
| Top of dam:                                                             | 35     |
| Spillway crest:                                                         |        |
| Service Spillway                                                        | 26     |
| Emergency Spillway                                                      | 32 ±   |

|                     |    |
|---------------------|----|
| Normal Pool:        | 26 |
| Maximum Pool (PMF): | 36 |

g. Dam

|                    |                                                                                                                                              |
|--------------------|----------------------------------------------------------------------------------------------------------------------------------------------|
| Type:              | Rolled Earthfill                                                                                                                             |
| Length:            | 485 feet                                                                                                                                     |
| Structural Height: | 63.5 feet                                                                                                                                    |
| Hydraulic Height:  | 58.5 feet                                                                                                                                    |
| Top width:         | 25.0 feet                                                                                                                                    |
| Side slopes:       |                                                                                                                                              |
| Downstream         | 1V to 2.75H                                                                                                                                  |
| Upstream           | 1V to 3.00H (As shown on design drawings)                                                                                                    |
| Zoning:            | Drawings show a "Clay Core" with undefined materials upstream and downstream of the core.                                                    |
| Impervious core:   | "Clay Core" has a top width of 20 feet and a bottom width of 50 feet, located at the upstream edge of the dam crest.                         |
| Cutoff:            | Drawings show a clay cutoff trench with a 20 foot bottom width, a 50 foot top width, a typical depth of 5 feet, and side slopes of 1V to 3H. |
| Grout curtain:     | None                                                                                                                                         |

|                                    |      |
|------------------------------------|------|
| h. Diversion and Regulating Tunnel | None |
|------------------------------------|------|

i. Spillway

|                    |              |
|--------------------|--------------|
| Type:              |              |
| Service Spillway   | Drop inlet   |
| Emergency Spillway | Open channel |
| Length of weir:    |              |

|                    |                                                                    |
|--------------------|--------------------------------------------------------------------|
| Service Spillway   | 3-foot diameter drop inlet pipe                                    |
| Emergency Spillway | 74 feet (top width of V-shaped<br>channel at top of dam elevation) |

Crest Elevation (feet above MSL):

|                    |       |
|--------------------|-------|
| Service Spillway   | 814   |
| Emergency Spillway | 819.6 |

|                       |      |
|-----------------------|------|
| j. Regulating Outlets | NONE |
|-----------------------|------|

\* In this section maximum pool refers to top of dam elevation, unless otherwise specified.

## SECTION 2 : ENGINEERING DATA

### 2.1 Design

A limited set of drawings for Woodridge Lake Dam have been made available from the engineering firm of Stolwyk, McDaniel, Ferrenbach of Clayton, Missouri. This firm has designed several dams in the central Missouri area. The local Soil Conservation Office in Warrenton has no records for this impoundment.

### 2.2 Construction

According to the owners, the dam has been constructed of native clay. The contractor for the dam was Norvell Construction of St. Louis, Missouri. The only construction data available was that received from the engineer and is included in this report.

### 2.3 Operation

The only record of operation for the lake and dam was obtained verbally from one of the trustees of Woodridge. Normal operation is to allow the lake to remain as full as possible while being controlled by rainfall, runoff, evaporation, and the drop inlet structure.

## 2.4 Evaluation

### a. Availability

The only available data for the project includes two drawings. No pertinent data was available for review of hydrology, spillway capacity, flood routing through the reservoir, outlet capacity, slope stability, seepage analysis, or foundation conditions.

### b. Adequacy

The available engineering data is inadequate to aid in evaluating the hydraulic and hydrologic capabilities and stability of the dam for Phase I investigations.

The lack of engineering data did not allow for a definitive review and evaluation. Therefore, the adequacy of this dam could not be assessed from the standpoint of reviewing and evaluating design, operation and construction data, but is based primarily on visual inspection, past performance history, and sound engineering judgment.

Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.

c. Validity

The data given on the available drawings appears to describe the constructed embankment and spillways. The drawings give few details for the dam and appurtenant structures.

### SECTION 3: VISUAL INSPECTION

#### 3.1 Findings

##### a. General

A visual inspection of the Woodridge Lake Dam was made on May 16, 1979. The following persons were present during the inspection:

| <u>Name</u>    | <u>Affiliation</u>               | <u>Disciplines</u>                               |
|----------------|----------------------------------|--------------------------------------------------|
| Dr. M.A. Samad | Engineering Consultants, Inc.    | Project Engineer,<br>Hydraulics and<br>Hydrology |
| Jon Diebel     | Engineering Consultants, Inc.    | Structural and<br>Mechanical                     |
| Peter Strauss  | Engineering Consultants, Inc.    | Soils                                            |
| Peter Howard   | Engineering Consultants, Inc.    | Geology                                          |
| Kevin Blume    | Consoer, Townsend & Assoc., Ltd. | Civil and<br>Structural                          |

Specific observations are discussed below.

b. Dam

A water pipe is located on the upstream face of the dam near the right abutment. A representative of the owner reported that the 2 inch diameter pipeline travels parallel to the roadway and is buried about 3-4 feet deep in the upstream face.

The shoreline shows much scalloping and subsequent sloughing from wave action. Where the embankment is scalloped a 1 1/2 to 3 foot high scrap is seen. The steepened angle of the scrap can be seen sloughing back to its angle of repose.

Numerous small erosion gullies exist on the downstream face. A drainage gully exists in the natural ground close to the downstream right abutment contact. At present there is no danger to the embankment.

A drainage gully at the downstream left abutment contact is eroding both embankment material and natural ground. This gully extends from the dam crest to the toe. This gully ranges from 2-5 feet wide and from 3-4 feet deep. The side walls are nearly vertical and are sloughing.

The crest and the downstream slope of the embankment appears to be in good condition. The crest appears to be adequately protected and the downstream embankment slope is an even slope with a good vegetative cover. No rodent activity was observed on the embankment.

The rocks underlying the dam are cherty limestones and dolomite limestones of Mississippian age (Osagean). These rocks are resting unconformably on Kinderhookian rocks (Chouteau Formation) and the contact between the rocks is about one mile south of the damsite. These rocks are exposed near both abutments of the dam. The beds are dipping very gently to the northwest. This apparent swing in dip from the regional dip to the northeast may be related to the Warren County anticline 4 1/2 miles to the north.

The Soil Conservation Service (Soil Survey of Montgomery and Warren Counties, Missouri, 1978) reports the soils forming the bottom land at the damsite are composed of silty sands (SM) and silty gravels (GM). The upslope soils consist of silty gravel (GM, GC) low on the slope and silty clay (CL-ML), sandy clay (CL, SC) and clay (CH, MH) higher up.

The carbonate of the Osagean series (Mississippian) are flat lying competent rocks and are suitable for a dam foundation. No serious fault or shear zones are known to exist in the vicinity of the dam. Ideally potential solution channels, such as joints, should be blanketed upstream of the toe and abutments. It is not known how the placement of the fill at the base and abutments of the dam was done. However, there is no indication of leakage at the abutments.

c. Appurtenant Structures

(1) Spillway

The service spillway pipe appeared to be in satisfactory condition. The intake end, with anti-vortex plate and trashrack, and the discharge end of the pipe are both in good condition. The discharge end of the pipe was not constructed with a headwall, and the embankment material is beginning to erode under the pipe. It appears that this undercutting of the pipe will continue until protection is provided for the material at this location. A small pool has formed downstream of the discharge end of the spillway pipe. This pool will not drain in its current condition.

The general condition of the emergency spillway is satisfactory. However, it appears that discharges through the spillway will flow down the left abutment contact. Some erosion gullies having a maximum size of 3 feet deep by 3 feet wide have formed along the abutment contact at this time. Discharges through the spillway flow into a slough area which has formed downstream of the toe of the dam. This area is marshy and filled with cattails and other phreatophyte.

(2) Outlet Works

There is no operating outlet pipe or low level drain pipe at the dam.

d. Reservoir Area

The water surface elevation was 814 feet above MSL at the time of inspection.

The reservoir rim is gently to moderately sloping with trees and woods near the slope. No evidence of any instability was observed.

e. Downstream Channel

The downstream channel is well defined with some vegetative and tree growth about 100 feet downstream from the spillway discharge area. No major obstacles or debris were observed along the downstream channel. Only minor erosion could be observed in a few areas.

3.2 Evaluation

The following problems were observed which could affect the safety of the dam or which will require maintenance within a reasonable period of time.

1. Deep erosion gulley along downstream left abutment contact, and erosion gullies at the right abutment contact.
2. Wave erosion on the upstream embankment slope.
3. Poorly channelized exit for the emergency spillway discharges which causes ponded water at downstream toe and erosion along the left abutment contact.

4. Undercutting on the discharge end of the service spillway pipe, and the ponded water found downstream of this pipe.

## SECTION 4: OPERATIONAL PROCEDURES

### 4.1 Procedures

There are no set operational procedures for Woodridge Lake Dam. As mentioned in Section 2, the lake is allowed to remain as full as possible as a result of the natural phenomena of rainfall, evaporation, runoff and the drop inlet structure discharge.

### 4.2 Maintenance of Dam

Woodridge Lake Dam is maintained by the resident trustees and several land owners around the lake. Since the structure is fairly new, no trees or shrubs were noticed on either slope.

There is a two lane gravel road along the crest of the dam which provides satisfactory protection for the crest.

The upstream slope seems to be slightly eroded near the water surface. There is no riprap in this area. There are erosion gullies forming at each abutment on the downstream side near the emergency spillway. This erosion should be arrested before it is allowed to erode the embankment material.

Financial records are kept by the trustees regarding maintenance but no physical records were available for this report.

4.3      Maintenance of Operating Facilities

The only facility at the damsite which requires any attention is the 36 inch steel pipe drop inlet structure. There are no gates or valves associated with this spillway and the trash rack is a series of bars which are welded to the top of the pipe below the anti-vortex plate.

4.4      Description of Any Warning System in Effect

The inspection team is not aware of any warning system in use at the dam site.

4.5      Evaluation

The operation and maintenance for Woodridge Lake Dam seems to be adequate. The trustees and local maintenance personnel live in close proximity to the dam and its surrounding areas.

## SECTION 5: HYDRAULIC/HYDROLOGIC

### 5.1 Evaluation of Features

#### a. Design

The watershed area of the Woodridge Lake Dam upstream from the dam axis consists of approximately 420 acres. Most of the watershed area is wooded and covered with grass. Land gradients in the higher regions of the watershed average roughly 8 percent, and in the lower areas surrounding the reservoir average about 4 percent. The Woodridge Lake Reservoir is located on an unnamed tributary of Dry Creek. The reservoir is about 1000 feet upstream from the confluence of the unnamed tributary and Dry Creek. At its longest arm the watershed is approximately 1 1/4 mile long. A drainage map showing the watershed area is presented as Plate 1 in Appendix B.

Evaluation of the hydraulic and hydrologic features of Woodridge Lake Dam was based on criteria set forth in the Corps of Engineers' Recommended Guidelines for Safety Inspection of Dams, and additional guidance provided by the St. Louis District of the Corps of Engineers. The Probable Maximum Flood (PMF) was calculated from the Probable Maximum Precipitation (PMP) using the methods outlined in the U.S. Weather Bureau Publication, Hydrometeorological Report No. 33. The probable maximum storm duration was set at 24 hours, and storm rainfall distribution was based on criteria given in EM 1110-2-1411 (Standard Project Storm). The SCS method was used for deriving the unit hydrograph, utilizing the Corps of

Engineers' computer program HEC-1, (Dam Safety Version). The unit hydrograph parameters are presented in Appendix B. The SCS method was also used for determining loss rate. The hydrologic soil group of the watershed was determined by use of published soil maps. The hydrologic soil group of the watershed and the SCS curve number are also presented in Appendix B. The curve number, the unit hydrograph parameters, the PMP index rainfall and the percentages for various durations were directly input to the HEC-1 (Dam Safety Version) computer program to obtain the PMF hydrograph. The computed peak discharges of the PMF and one-half of the PMF are 7143 cfs and 3571 cfs respectively.

Both the PMF and one-half of the PMF inflow hydrographs were routed through the reservoir by the Modified Puls Method also utilizing the HEC-1 (Dam Safety Version) computer program. The reservoir was assumed at the spillway crest level at the start of routing computation. The peak outflow discharges for the PMF and one-half of the PMF are 5259 and 2325 cfs respectively. Both the PMF and one-half of the PMF, when routed through the reservoir results in overtopping of the dam.

The stage-outflow relation for the spillway was prepared from field notes, and sketches, prepared during the field inspection. The reservoir stage-capacity data were based on the U.S.G.S Warrenton Quadrangle topographic map (7.5 minute series). The spillway and overtop rating curve and the reservoir capacity curve are presented in Plates 2 & 3 respectively in Appendix B.

From the standpoint of dam safety, the hydrologic design of a dam aims at avoiding overtopping. Overtopping is especially dangerous for an earth dam because the downrush of waters over the crest will erode the dam embankment and release all the stored water into the downstream floodplain. The safe hydrologic design of a dam requires a spillway discharge capability, in combination with an embankment crest height that can handle a very large and exceedingly rare flood without overtopping.

The Corps of Engineer designs its dams to safely pass the Probable Maximum Flood that is estimated could be generated from the upstream watershed. This is the generally accepted criterion for major dams throughout the world, and is the standard for dam safety where overtopping would pose any threat to human life. According to the Corps criteria, the hydrologic requirement for safety for this dam is the capability to pass the Probable Maximum Flood without overtopping.

b. Experience Data

No records of reservoir stage or spillway discharge are maintained for this site. However, according to the representative of owner, the maximum reservoir level was about 6 inches above the crest of the service spillway.

c. Visual Observations

Observations made of the spillway during the visual inspection are discussed in Section 3.1c(1) and evaluated in Section 3.2.

d. Overtopping Potential

As indicated in Section 5.1-a, both the Probable Maximum Flood and one-half of the Probable Maximum Flood, when routed through the reservoir, resulted in overtopping of the dam. The peak outflow discharges for the PMF and one-half of the PMF are 5259 and 2325 cfs respectively. The PMF overtopped the dam crest 2.14 feet and one-half of the PMF overtopped the dam crest by 1.05 feet. The total duration of embankment overflow is 6.00 hours during the PMF, and 3.42 hours during one-half of the PMF. The spillway for Woodridge Lake Dam is capable of passing a flood equal to approximately 27 percent of the PMF just before overtopping the dam.

The computed one percent chance flood using 100-year, 24 hour rainfall data was routed through the reservoir, and is given in the last section in Appendix B. The routing results indicate the reservoir/spillway system will accomodate the 100-year flood without overtopping the dam.

The failure of the dam could cause extensive damage to the property downstream of the dam and possible loss of life. The estimated damage zone extends approximately 5-1/2 miles downstream of the dam. Within this zone, eleven dwellings and seven outbuildings may be found.

## SECTION 6: STRUCTURAL STABILITY

### 6.1 Evaluation of Structural Stability

#### a. Visual Observations

The wave action on the upstream slope of the embankment is causing substantial erosion and sloughing of embankment materials. Further erosion to the slope will decrease the embankment section, reducing its structural stability. This condition should be repaired by stabilization of the slope.

The erosion gullies on the abutment contacts also are removing parts of the embankment. These should be repaired to prevent the removal of additional embankment material.

The route of discharges through the emergency spillway threatens the structural integrity of the embankment. During a flood situation flows through the spillway could potentially erode a substantial amount of the embankment. This condition must be remedied by channelization of the route of the spillway discharges away from the embankment.

The undercutting of the material surrounding the service spillway pipe should be stopped by stabilization of the surrounding materials. Furthermore, the pond downstream of the spillway pipe should be drained by cutting a channel downstream of the pond to drain the standing water. The marshy area to the left of the spillway pipe is also undesir-

able, but will remain as long as spillway discharges through the emergency spillway flow along the abutment contact to the toe of the dam. Following channelization of the emergency spillway channel away from the embankment, this area should be filled with compacted earthfill such that a positive slope will exist into the streambed downstream of the dam.

No signs of settlement or distress were observed on the downstream slope of the dam or in the foundation. Seepage was not observed on the embankment or downstream of the toe of the embankment. The standing water and marshy areas are thought to be from surface drainage or spillway discharges.

b. Design and Construction Data

No design or construction data relating to the structural stability of the dam or appurtenant structures were found.

c. Operating Records

No operating records are available relating to the stability of the dam or appurtenant structures. Water levels have not been recorded, however, the reservoir was almost full on the day of inspection, and is assumed to be close to full at all times.

d. Post Construction Changes

No post construction changes are known to exist which will affect the structural stability of the dam.

e. Seismic Stability

According to the Seismic Zone Map of Contiguous States, Form TM 5-809-10/NAVFAC P-355/AFM 88-3 Chapter 13; April 1979, the portion of Missouri in which Woodridge Lake Dam is located is in Seismic Zone 2. The engineer performing the stability analysis on the embankment shall determine the necessity of a seismic analysis for this embankment.

## SECTION 7: ASSESSMENT/REMEDIAL MEASURES

### 7.1 Dam Assessment

The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

It should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team.

It is also important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that an unsafe condition could be detected.

#### a. Safety

The spillway capacity of Woodridge Lake Dam was found to be "Seriously Inadequate". The spillway/reservoir system will accomodate only 27 percent of the PMF without overtopping the dam. The spillway and the reservoir will accomodate the 100-year flood without overtopping the dam.

The dam is overtopped over two feet during the PMF and the duration of embankment overflow is six hours. If the body of the dam is made up of silty soils, overtopping could result in dam failure.

Several conditions exist at Woodridge Lake Dam which can jeopardize the safety of the structure. The sloughing and eroding of the embankment materials on the upstream embankment slope is a potentially dangerous condition. The slope should be stabilized by either flattening of the embankment slope or by the addition of rock riprap to the embankment slope.

The handling of surface drainage and spillway discharges are causing structural problems at the damsite. Erosion gullies are present at both abutment contacts. These should be repaired, and future erosion prevented by proper grading at the abutments of the dam.

The left abutment contact is being further damaged by flows through the emergency spillway. This condition should be remedied by channelizing the discharges through the spillway away from the embankment. Following this work, the marshy condition and ponds at the downstream toe of the embankment should be drained and filled with compacted earth-fill.

The dam has no available stability or seepage analysis. To assure that conventional stability safety factors are comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" exist, stability analyses should be made.

b. Adequacy of Information

Adequate information concerning the dam and appurtenant structures is not available. No seepage and stability analyses were available for review.

c. Urgency

The remedial measures recommended in Paragraph 7.2 should be accomplished in the near future. The items recommended in paragraph 7.2a should be pursued on a high priority basis.

d. Necessity for Phase II Inspection

Based on results of the Phase I inspection, and if the remedial measures recommended in Paragraph 7.2 are undertaken as soon as possible, a Phase II inspection is not felt to be necessary.

7.2 Remedial Measures

a. Alternative:


1. Spillway capacity and/or height of the dam should be increased to accomodate the PMF without overtopping the dam.

b. O & M Procedures:


1. Stabilize the upstream embankment slope to prevent future sloughing and erosion due to wave action.

2. Channelize the emergency spillway discharge channel to prevent discharges through the spillway from flowing along the left abutment contact of the dam.
3. Repair the erosion gullies at the abutment contacts, and prevent further erosion by proper grading of the abutments of the dam.
4. Stabilize the material surrounding the downstream end of the service spillway pipe by the addition of a concrete headwall on the end of the pipe or rock riprap on the slope.
5. Drain the pond downstream of the service spillway pipe, and fill the marshy area to the left of this pipe with compacted earth.
6. Seepage and stability analyses should be performed by a professional engineer experienced in the design and construction of earth dams.
7. The owner should initiate the following programs.
  - (a) Periodic inspection of the dam by a professional engineer experienced in the design and construction of earthen dams.
  - (b) Set up a maintenance schedule and log all visits to the dam for operation, repairs and maintenance.

PLATES

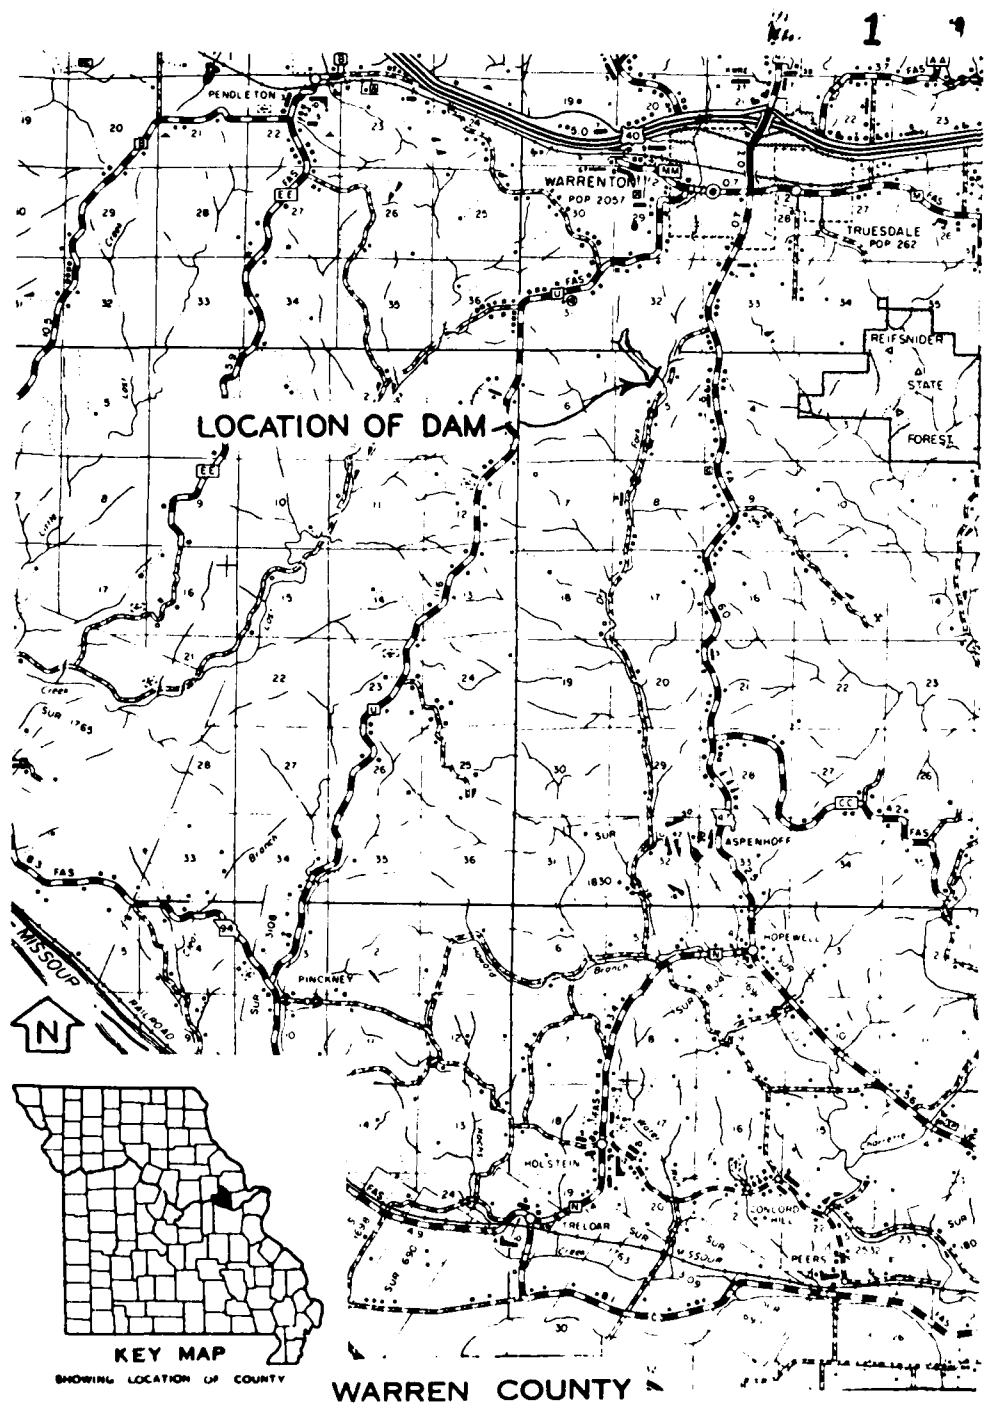


LOCATION MAP - WOODRIDGE LAKE DAM

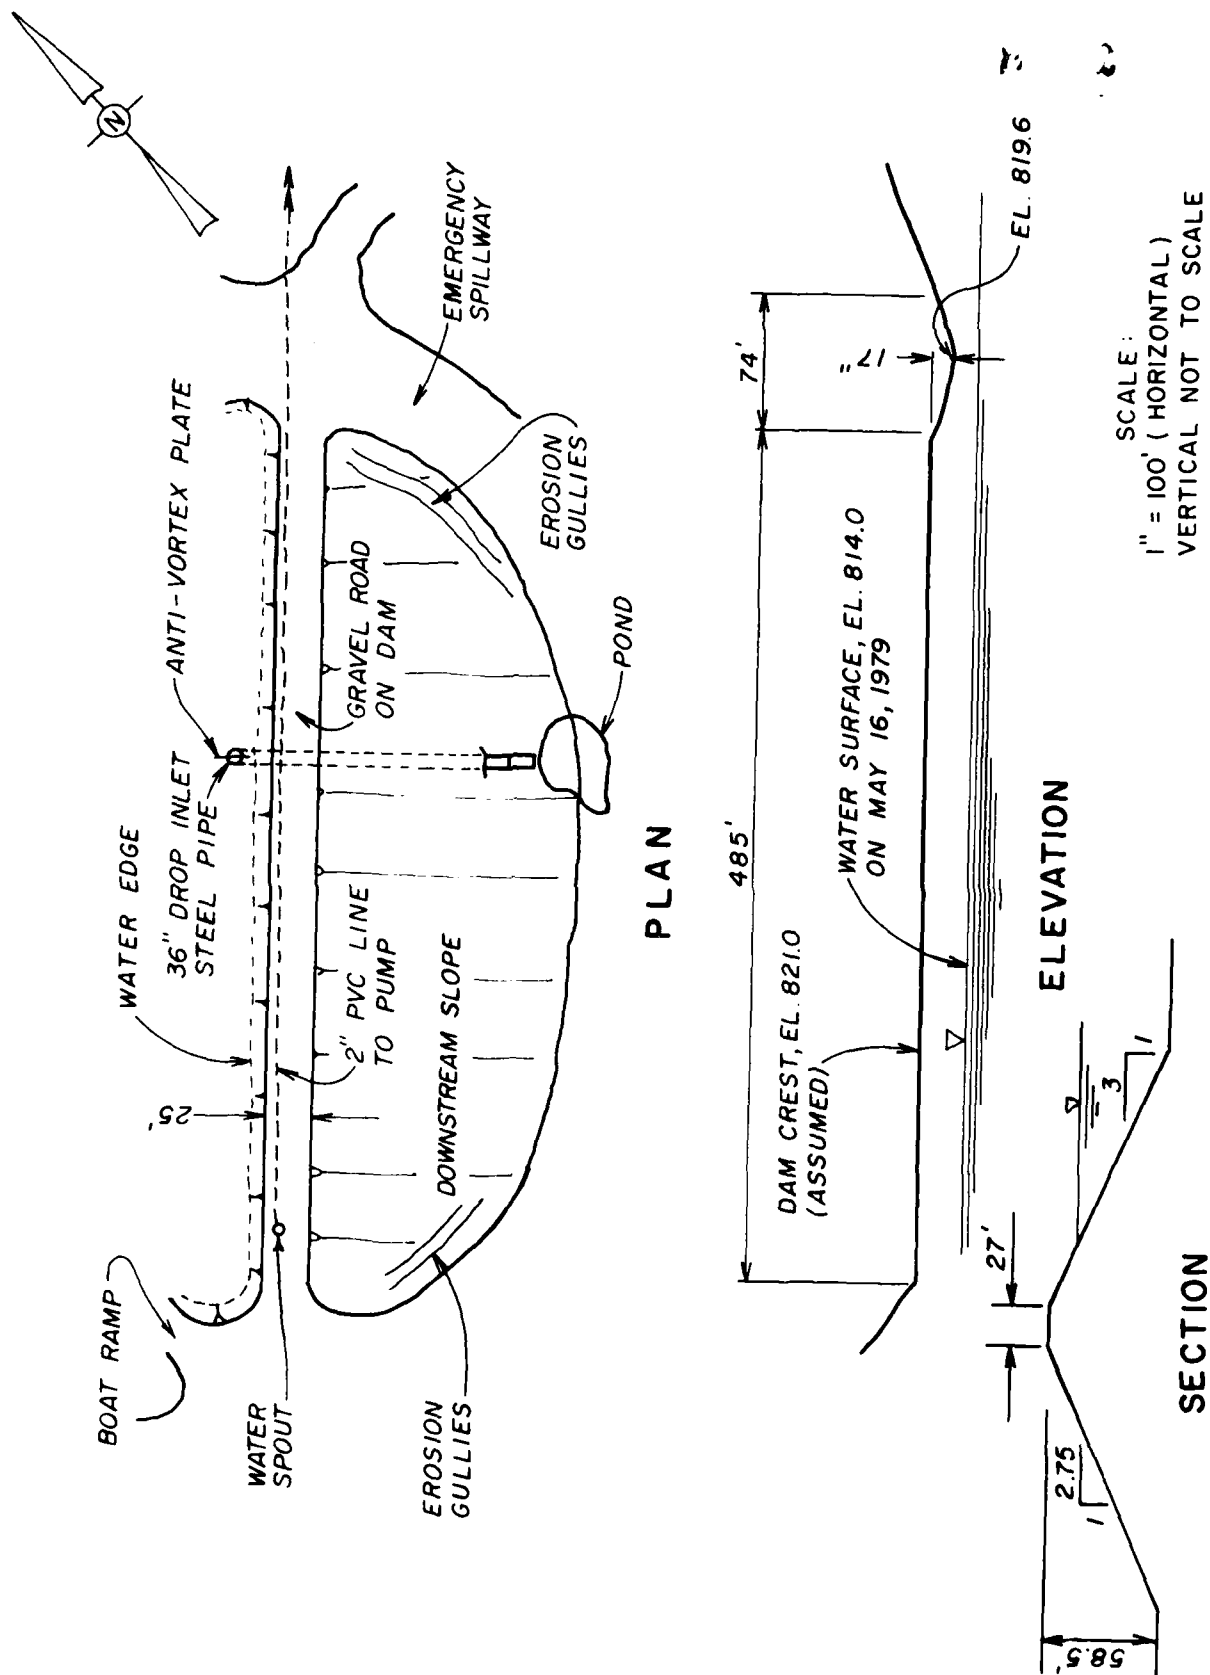

WOODRIDGE LAKE DAM (MO. 11005)  
PLAN, ELEVATION & SECTION



AF 46747N H 2 W  
 SECTION 5, 3632  
 WARREN CO. MO.

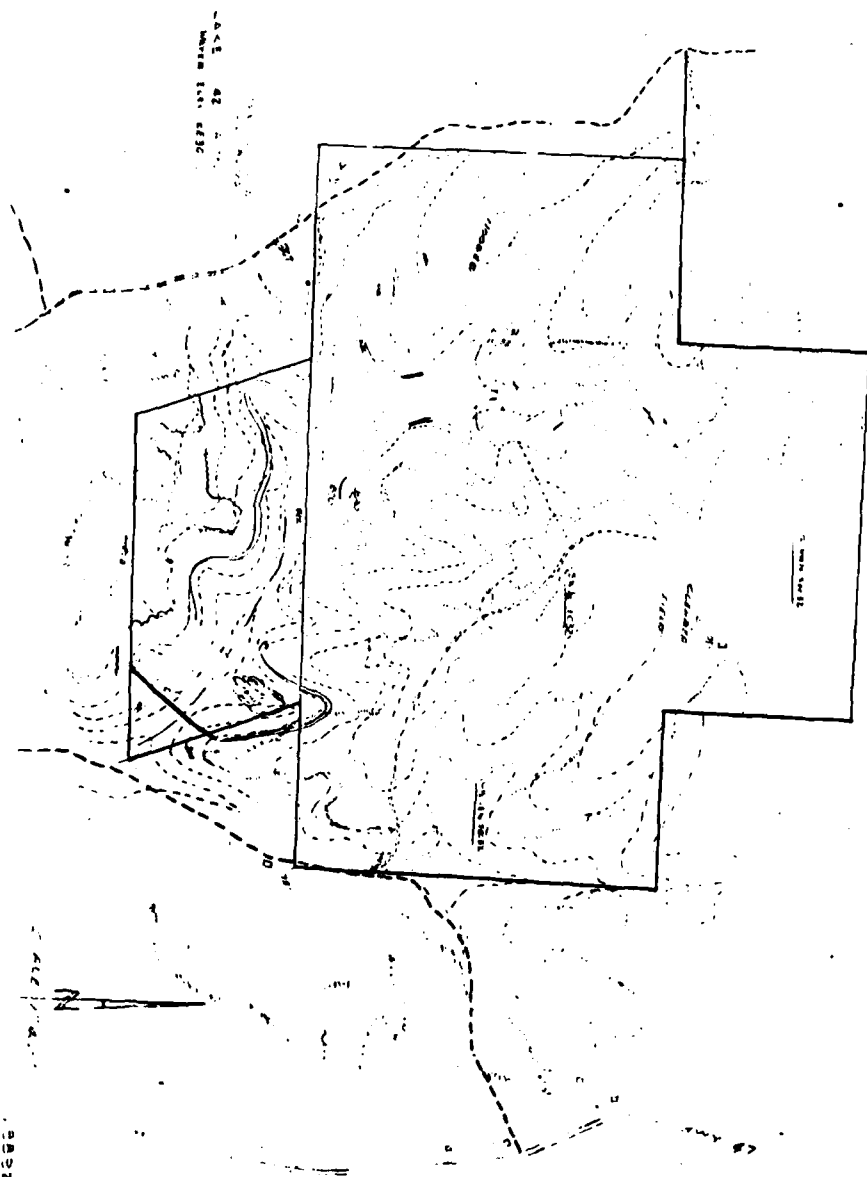

3632



DEPARTMENT OF THE ARMY  
ST. LOUIS DISTRICT, CORPS OF ENGINEERS  
210 NORTH 12TH STREET  
ST. LOUIS, MISSOURI 63101

IN REPLY REFER TO

SUBJECT: Woodridge Lake Dam (Mo. 11005) Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Woodridge Lake Dam (Mo. 11005).

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria:

- 1) Spillway will not pass 50 percent of the Probable Maximum Flood
- 2) Overtopping could result in dam failure
- 3) Dam failure significantly increases the hazard to loss of life downstream

SUBMITTED BY: \_\_\_\_\_  
Chief, Engineering Division Date

APPROVED BY: \_\_\_\_\_  
Colonel, CE, District Engineer Date


# GENERALIZED GEOLOGIC MAP OF MISSOURI

GEOL. SURV. AND LAND SURV. DEPT. OF NATURAL RESOURCES  
WILLIAM B. H. JR., Director & State Geologist  
1978

**LEGEND**

|   |                     |                                                                      |
|---|---------------------|----------------------------------------------------------------------|
| 8 | Tertiary-Quaternary | Ep. Central Area, New Madrid Earthquakes of 1811-1812                |
| 7 | Cretaceous          | Other Selected Ep. centers $\geq$ MM VI Since 1843                   |
| 6 | Pennsylvanian       | Other Selected Ep. centers $\geq$ MM VI 1950-1970 (Number of Events) |
| 5 | Mississippian       | Seismic Region (see text)                                            |
| 4 | St. Louis Division  | Border of Warren County                                              |
| 3 | Ordovician          |                                                                      |
| 2 | Cambrian            |                                                                      |
| 1 | PreCambrian         |                                                                      |

Note: Pre-Cambrian till and loess not shown

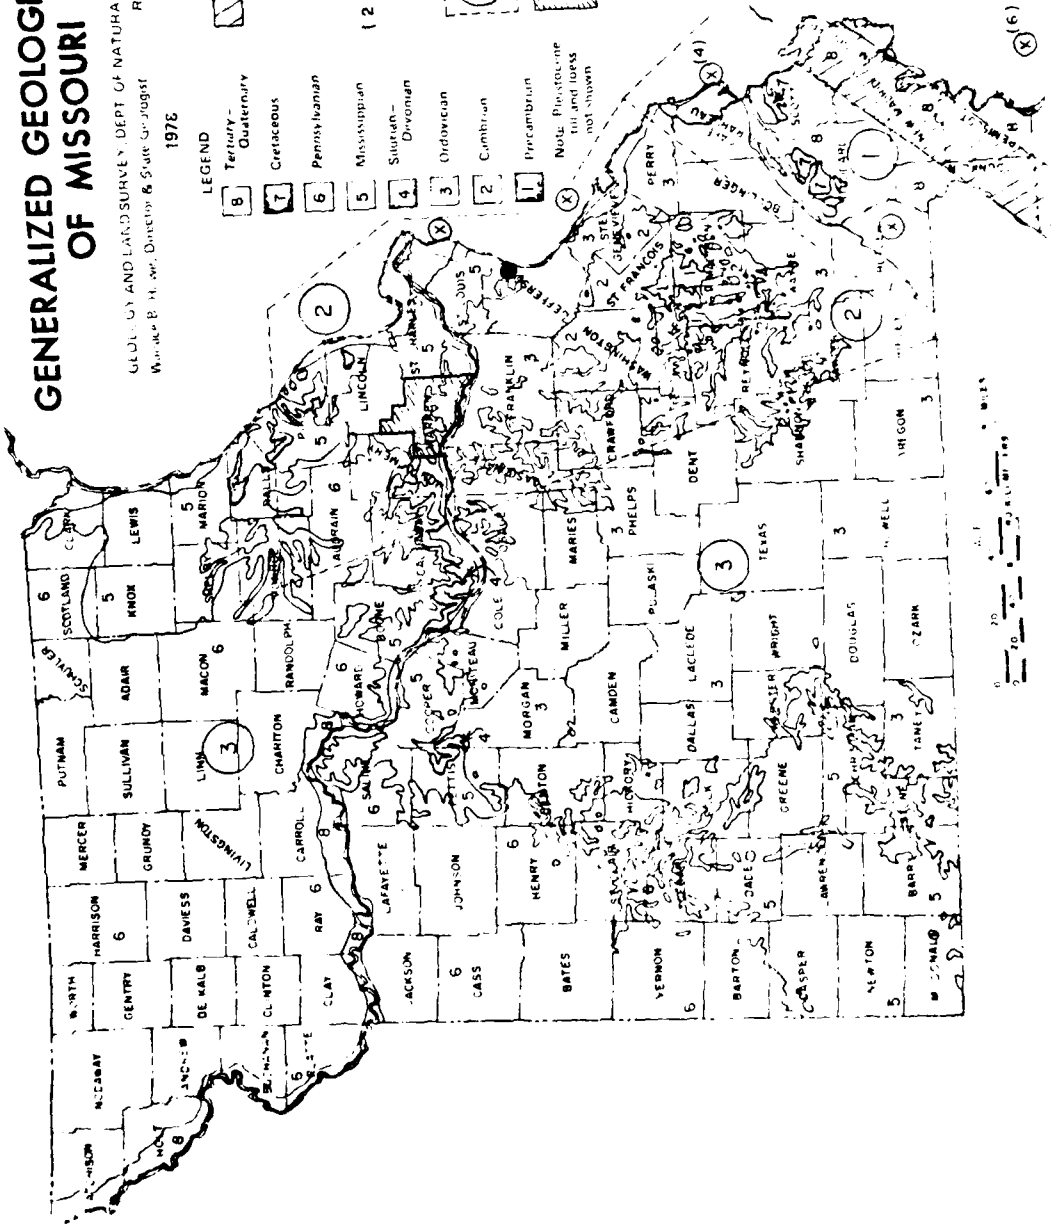



APPENDIX A

PHOTOGRAPHS TAKEN DURING INSPECTION

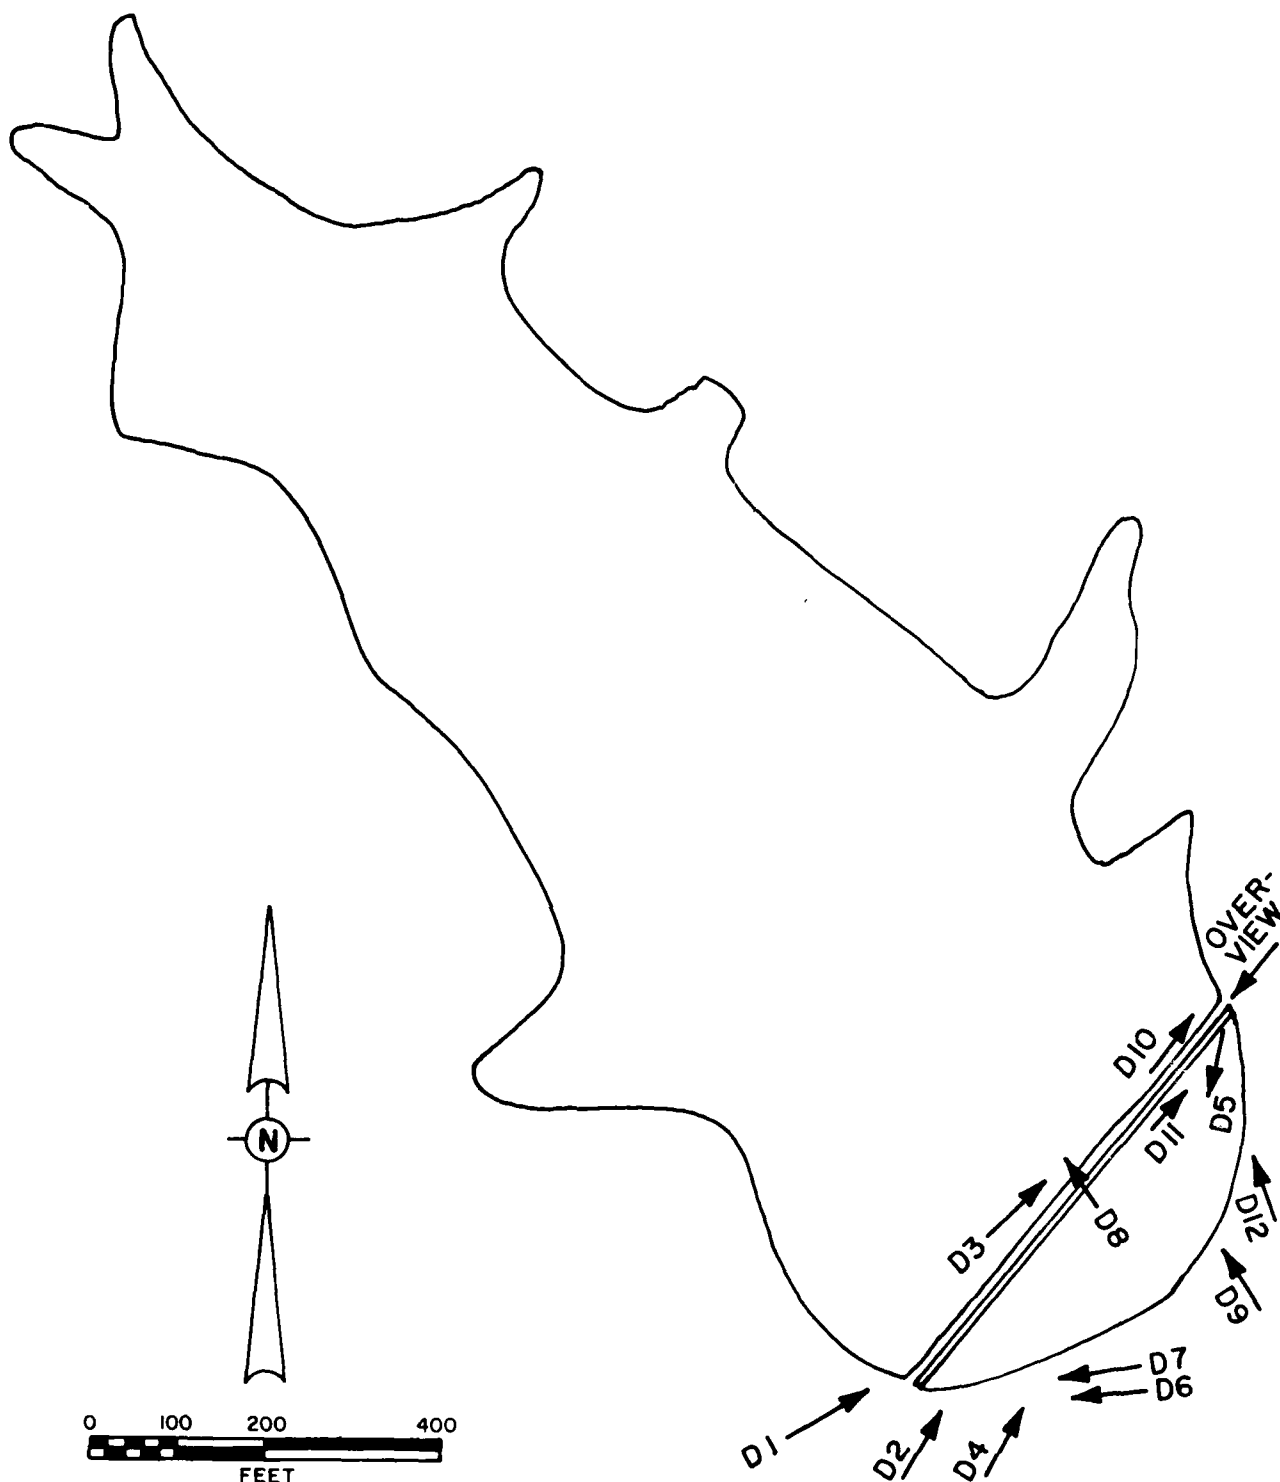


PHOTO INDEX  
FOR  
WOODRIDGE LAKE DAM

WOODRIDGE LAKE DAM

- D1 - Upstream Embankment Slope
- D2 - Downstream Embankment Slope
- D3 - Sloughing on Upstream Embankment Slope
- D4 - View Downstream of Dam
- D5 - View Downstream of Dam
- D6 - Erosion at Right Abutment Contact
- D7 - Erosion at Left Abutment Contact
- D8 - Service Spillway Intake
- D9 - Service Spillway Discharge
- D10 - Emergency Spillway
- D11 - Emergency Spillway
- D12 - Left Abutment Contact



D1



D2

Woodridge Lake Dam




D3



D4

Woodridge Lake Dam

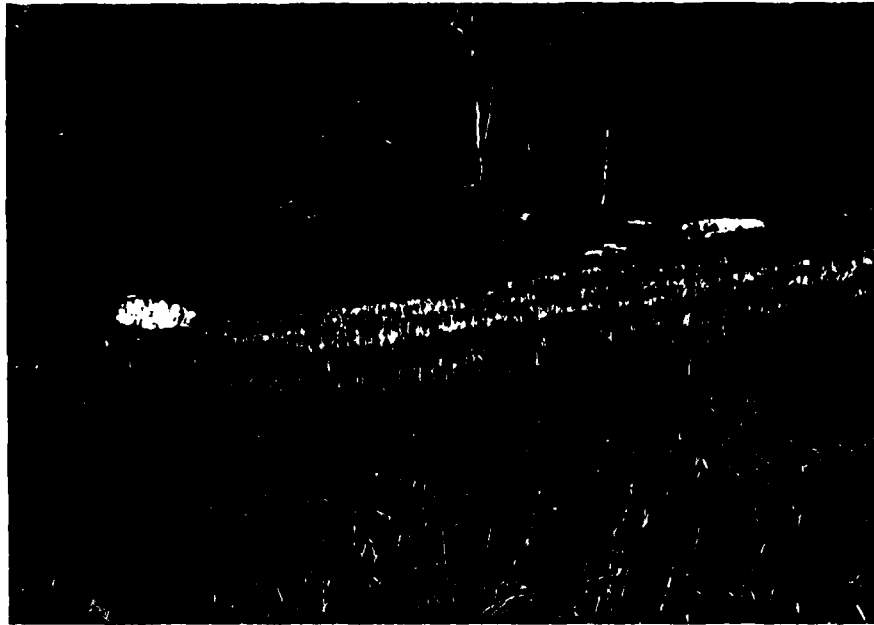


D5



D6

Woodridge Lake Dam

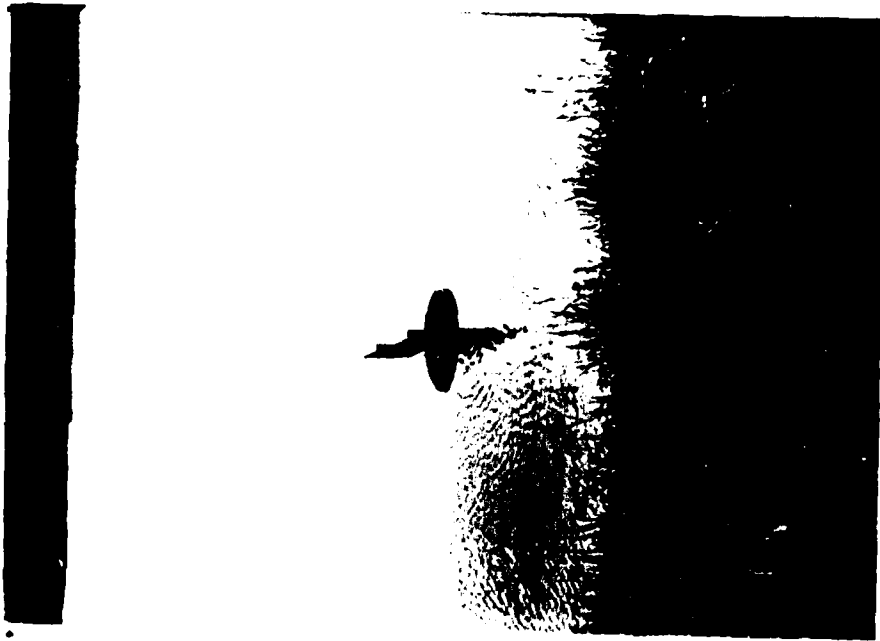

Woodridge Lake Dam



D9



D10

Woodridge Lake Dam



D11




D12

APPENDIX B

HYDROLOGIC COMPUTATIONS

PLATE -1, APPENDIX-B

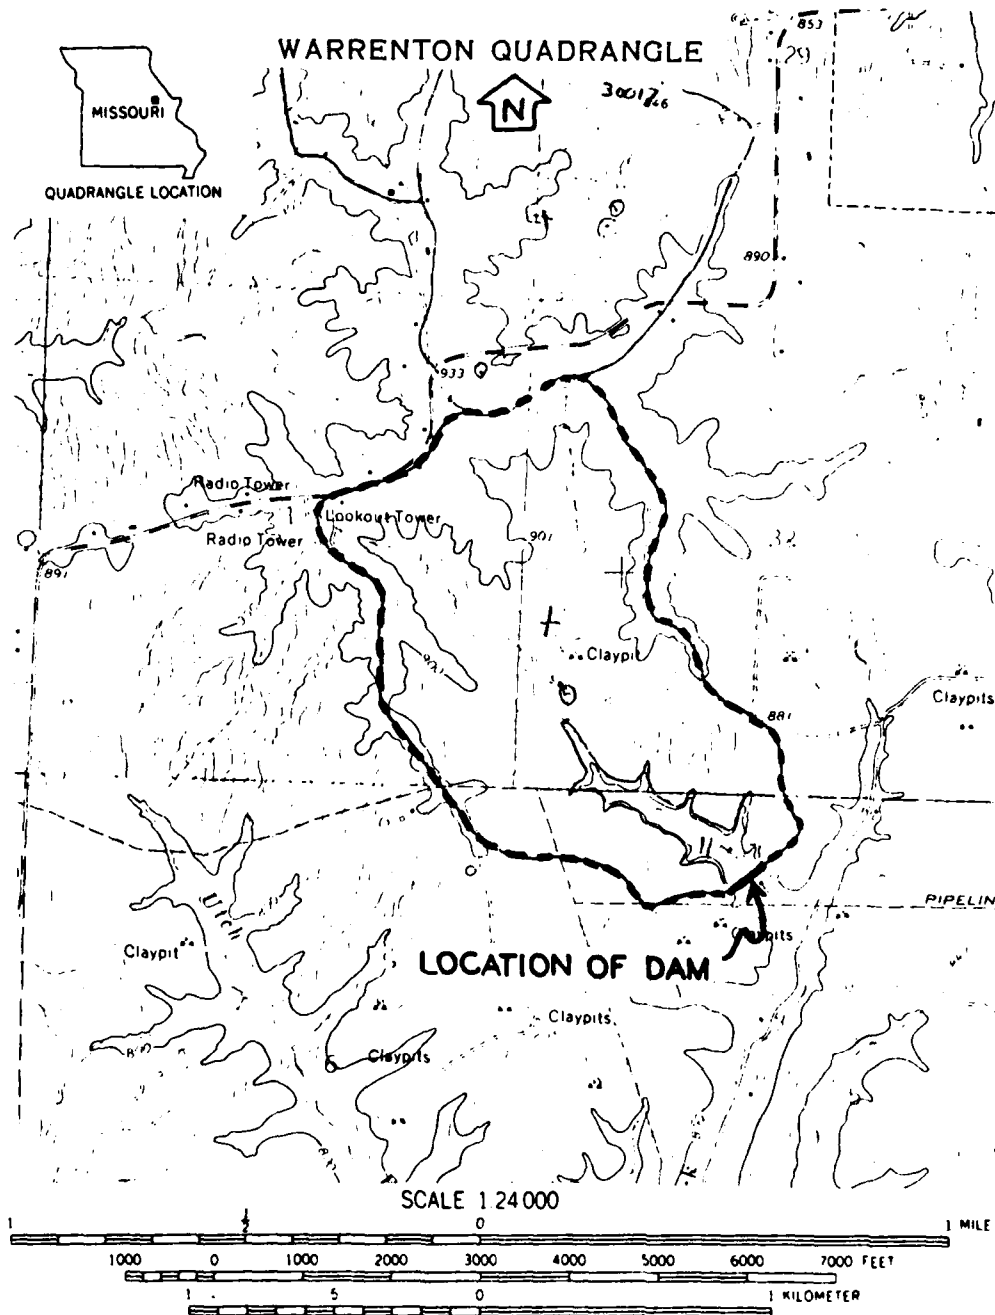

CONTOUR INTERVAL 20 FEET  
DATUM IS MEAN SEA LEVEL  
DRAINAGE BOUNDARY - - - - -

WOODRIDGE LAKE DAM (MO. 11005)  
DRAINAGE BASIN

DAM SAFETY INSPECTION - MISSOURI

MISSOURI DAM 11005

OVERTOP DISCHARGE RATING CURVE


SHEET NO. 1 OF

JOB NO. 1240-C01-1

BY NLB DATE 5-21-79  
M.R.H.

SPILLWAY SECTION

CRITICAL DEPTH ASSUMED IN

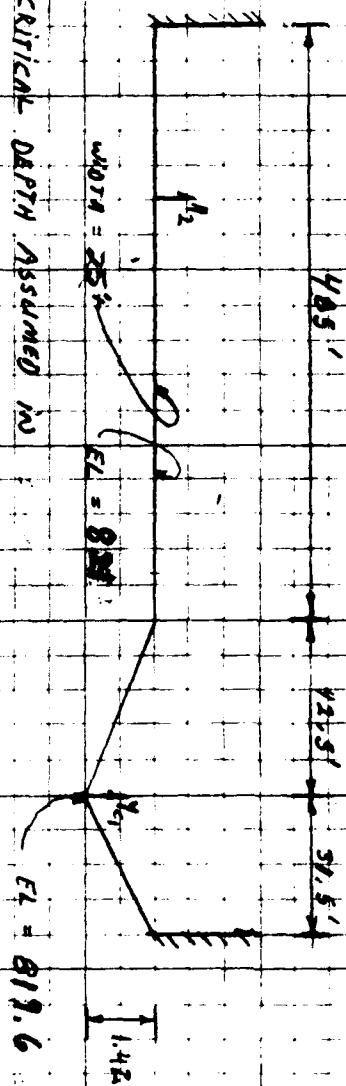

| $Y_1$<br>(ft) | $A_1$<br>(ft <sup>2</sup> ) | $T_1$<br>(ft) | $V_1 = \sqrt{\frac{g}{32.2} \frac{H_1}{Y_1}}$<br>(ft/s) | $\frac{V_1^2}{2g}$ | $Q_1 = A_1 V_1$<br>(cfs) | $\frac{V_1^2}{2g} + Y_1$ | $H_2$ | $C_2$ | $L_2$ | $Q_2 = C_2 L_2 H_2^2$ | $Q_T = Q_1 + Q_2$ |
|---------------|-----------------------------|---------------|---------------------------------------------------------|--------------------|--------------------------|--------------------------|-------|-------|-------|-----------------------|-------------------|
| 0             | 0                           | 0             | 0                                                       | 0                  | 0                        | 819.6                    | -     | -     | -     | -                     | 0                 |
| 1             | 26.06                       | 52.11         | 4.01                                                    | .25                | 104.49                   | 820.85                   | -     | -     | -     | -                     | 104.49            |
| 1.42          | 52.54                       | 74            | 4.78                                                    | .35                | 251.14                   | 821.37                   | .37   | 2.70  | 485   | 294.72                | 545.85            |
| 2.5           | 132.46                      | 74            | 7.59                                                    | .89                | 1004.83                  | 822.99                   | 1.99  | 2.63  | 485   | 3580.78               | 4585.61           |
| 3.5           | 206.46                      | 74            | 9.47                                                    | 1.39               | 1955.3                   | 824.49                   | 3.49  | 2.63  | 485   | 8316.4                | 10,271.70         |


DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 1 OF

MISSOURI DAM 11005

JOB NO. 1240-001-1

DROP INLET SPILLWAY RATING CURVE

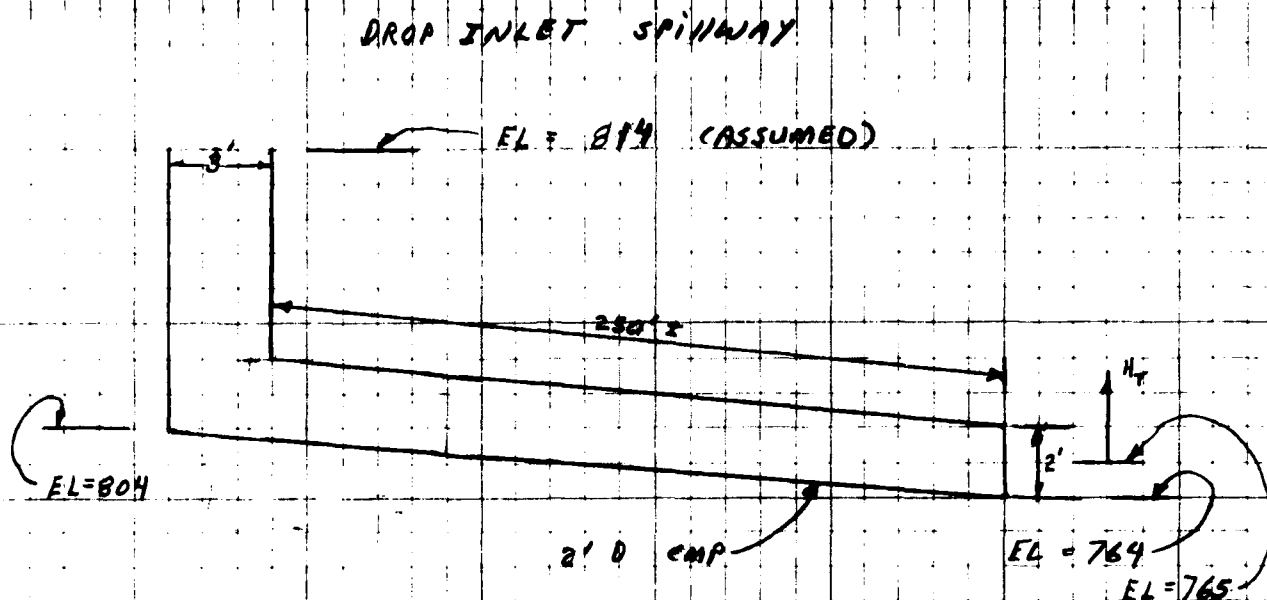BY KLB DATE 5-23-79  
M.P.H.

SPILLWAY DISCHARGE (ASSUME NO TAIL WATER EFFECT)

AT WL. 814.5

$$H_T = 814.5 - 814 = 0.5$$

a) WEIR FLOW:

ASSUME  $C = 3.03$ 

$$Q = CLH^{3/2} = 3.03 \times (\pi \times 3) \times 0.5^{3/2}$$

$$= 10.10 \text{ CFS}$$

b) PERMISSABLE FLOW THROUGH THE PIPE.

$$\text{SLOPE OF THE PIPE} = S = \frac{804 - 764}{250}$$

$$S = \frac{400}{250} = 0.160 \text{ FT/FT}$$

## DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 2 OF

MISSOURI DAM 11005

JOB NO. 1240-001-1

## DROP INLET SPILLWAY RATING CURVE

BY XLB DATE 5-23-71  
M.E.S.

## b) CRITICAL SLOPE

$$Z = \frac{Q}{\sqrt{g}} = \frac{10.10}{\sqrt{32.2}} = 1.78$$

$$\frac{Z}{d_0^{2.5}} = \frac{1.78}{2^{2.5}} = 0.81$$

$$\text{FOR } \frac{Z}{d_0^{2.5}} = 0.81, \quad \frac{Y_c}{d_0} = 0.56 \Rightarrow Y_c = 1.12'$$

$$S_c = \left( \frac{Q^{1.49}}{1.49 AR^{2.49}} \right)^2$$

$$\text{ASSUME } m = 0.014$$

$$\frac{Y_c}{d_0} = 0.56 \Rightarrow \frac{A}{A_0} = 0.58 \quad \& \quad \frac{R}{R_0} = 1.07$$

$$\text{WHERE } A_0 = \frac{\pi}{4} d_0^2 = 0.7854 \times 2^2$$

$$= 3.14'$$

$$R_0 = 0.25 d_0 = 0.25 \times 2 = 0.50'$$

$$A = 0.58 \times 3.14 = 1.82'$$

$$R = 1.07 \times 0.50 = 0.54'$$

$$S_c = \left( \frac{10.10 \times 0.014}{1.49 \times 1.82 \times 0.54^{2.49}} \right)^2$$

$$= 0.006 < S, \Rightarrow \text{PIPE SLOPE IS SUPER CRITICAL}$$

∴ CONTROL IS CRITICAL DEPTH AT WEIR

$$\text{AND } \boxed{Q = 10.10 \text{ CFS}}$$

## DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 3 OF

MISSOURI DAM NO. 6

JOB NO. 1240-001-1

SPILLWAY RATING CURVE

BY KLB DATE 5-23-79

WL AT 815:

## a) WEIR FLOW

$$Q = CLH^{3/2} = 3.03 \times (\pi \times 3) \times 7^{3/2} = 28.56 \text{ CFS.}$$

## b) PERMISSIBLE DISCHARGE THROUGH PIPE

$$Z = \frac{Q}{\sqrt{g}} = \frac{28.56}{\sqrt{32.2}} = 5.03$$

$$\frac{Z}{d_0^{2.5}} = \frac{5.03}{2^{2.5}} = 0.89$$

$$\Rightarrow \frac{y_c}{d_0} = 0.92 \Rightarrow y_c = 1.84$$

$$\frac{y_c}{d_0} = 0.92 \Rightarrow \frac{A}{A_0} = 0.96 \text{ \& } \frac{R}{R_0} = 1.18$$

$$A = 0.96 \times \frac{\pi}{4} \times (2^2) = 3.02$$

$$R = \frac{1}{4} (2) \times 1.18 = 0.59$$

$$S_c = \left( \frac{28.56 \times 0.014}{1.49 \times 3.02 \times 0.59^{2/3}} \right)^2 = 0.017 \text{ \& } S = 0.16$$

$\Rightarrow$  SLOPE IS SUPERCRITICAL

$\therefore$  PIPE FLOW IS SUPERCRITICAL  
AND CONTROL WOULD BE FOR  
WEIR CONDITIONS IF PRESSURE  
FLOW DOES NOT OCCUR.

SINCE  $y_c = 1.84 \approx d_0 = 2.0$   
CHECK FOR PRESSURE FLOW.

## c) PRESSURE FLOW.

$$H_T = \left( 1 + K_f + f \frac{L}{D} \right) \frac{V^2}{2g}$$

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 4 OF

MISSOURI DAM 11005

JOB NO. 1240-001-1

SPILOWAY RATING CURVE

BY KLB DATE 5-23-79  
M.R.H. ✓

WL AT 815 (CONT.)

C) CHECK PRESSURE FLOW

ASSUME  $K_c = 0.10$  $f = 0.023$  FOR  $m = 0.019$ 

$$H_T = \left( 1.0 + 0.10 + 0.023 \frac{250}{2} \right) \frac{V^2}{2g}$$

$$H_T = 3.98 \frac{V^2}{2g}$$

$$V = \sqrt{\frac{2g H_T}{3.98}} = 4.02 \sqrt{H_T}$$

$$Q = A \cdot V = \frac{\pi}{4} \times 2^2 \times 4.02 \sqrt{H_T}$$

$$Q = 12.63 \sqrt{H_T}$$

$$H_T = 815 - 765 = 50.0$$

$$Q = 12.63 \sqrt{50} = \underline{89.31} \text{ CFS} > 28.56$$

∴ AT ELEV 815, WEIR FLOW

CONTROLS. USE  $Q = 28.56$ WL AT 816

a) WEIR FLOW

$$Q = CLH^{3/2} = 3.03 \times (\pi \times 3) \times 2^{3/2}$$

$$Q = 80.77 \text{ CFS}$$

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 5 OF

MISSOURI DAM 11005

JOB NO. 1240-001-1

SPILLWAY RATING CURVE

BY KLB DATE 5-23-79

M.R.A. ✓

WL. AT 816.

b) PERMISSIBLE DISCHARGE IN PIPE

$$Z = \frac{Q}{\sqrt{g}} = \frac{80.77}{\sqrt{32.2}} = 14.23$$

$$\frac{Z}{d_0^{2.5}} = \frac{14.23}{2^{2.5}} = 2.52$$

$$\Rightarrow \frac{Y_c}{d_0} = 0.98, \Rightarrow \frac{A}{A_0} = 0.995, \frac{R}{R_0} = 1.09$$

$$\frac{Y_c}{d_0} = 0.98 \Rightarrow Y_c = 1.96$$

$$A = 0.995 \times \frac{\pi}{4} \times (2^2) = 3.13$$

$$R = \frac{1}{4} (2) \times 1.09 = 0.55$$

$$S_c = \left( \frac{80.77 \times 0.014}{1.49 \times 3.13 \times 0.55^{4/3}} \right)^2 = 0.13 < S = 0.16$$

$\Rightarrow$  SLOPE IS SUPERCRITICAL

SINCE  $Y_c = 1.96 \approx d_0 = 2.0$

CHECK PRESSURE FLOW

c) PRESSURE FLOW

$$Q = 12.63 \sqrt{H_t}$$

$$H_t = 816 - 765 = 51$$

$$Q = 12.63 \sqrt{51} = 90.20 > 80.77$$

$\therefore$  FLOW IS CONTROLLED BY WEIR FLOW AT THE CREST AND  $Q = 80.77$

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 6 OF

MISSOURI DAM 11005

JOB NO. 1240-001-1

SPILLWAY RATING CURVE.

BY XLB

DATE 5-23-79

M.R.H. ✓

WL AT B17

a) WEIR FLOW

$$Q = CLH^{3/2} = 3.03 \times (\pi \times 3) \times 3^{3/2} = 148.39$$

b) PERMISSABLE FLOW IN PIPE.

$$Z = \frac{Q}{Vg} = \frac{148.39}{\sqrt{32.2}} = 26.15$$

$$\frac{Z}{d_0^{2.5}} = \frac{26.15}{2^{2.5}} = 4.62$$

$$\Rightarrow \frac{Y_c}{d_0} = 0.98, \Rightarrow \frac{A}{A_0} = 0.995, \frac{R}{R_0} = 1.09$$

$$\frac{Y_c}{d_0} = 0.98, \Rightarrow Y_c = 3 \sqrt[1.96]{13}$$

$$A = 0.995 \times \frac{\pi}{4} \times (2^2) = 3.13$$

$$R = \frac{1}{4}(2) \times 1.09 = 0.55$$

$$S_c = \left( \frac{148.39 \times 0.014}{1.49 \times 3.13 \times 0.55^{2/3}} \right)^2 = 0.44 > S = 0.16$$

SLOPE IN THE PIPE IS NOW SUB-CRITICAL.

CHECK ORIFICE FLOW

c) ORIFICE FLOW

$$\text{ASSUME } C = 0.62, H_T = 817 - 765 = 52$$

$$Q = CA \sqrt{2gH_T}$$

$$Q = 0.62 \times \left( \frac{\pi}{4} \times 2^2 \right) \times \sqrt{64.4 \times 52}$$

$$Q = 112.72 < 148.39$$

∴ ORIFICE FLOW CONTROLS IF PRESSURE  
FLOW DOES NOT.

## DAM SAFETY INSPECTION - MISSOURI

MISSOURI DAM 11005

SPILLWAY RATING CURVE.

SHEET NO. 7 OF

JOB NO. 1240-001-1

BY KLB DATE 5-23-79

M.R.H.

WL AT 817 (CONT)

d) CHECK PRESSURE FLOW.

$$Q = 12.63 \sqrt{H_z}$$

$$H_z = 817 - 765 = 52 \text{ FE}$$

$$Q = 12.63 \sqrt{52} = \underline{91.08} < 112.72$$

∴ AT ELEVATION 817

PRESSURE FLOW CONTROLS

$$\underline{Q = 91.08} \text{ CFS}$$

AND FOR ALL ELEVATIONS ABOVE

817 PRESURE FLOW WILL CONTROL

THAT IS. USE THE EQUATION

$$Q = 12.63 \sqrt{H_z} \text{ FOR ALL}$$

ELEVATIONS ABOVE 817.

## DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 1 OF

MISSOURI DAM 11005

JOB NO. 1240-001-1


## COMBINED SPILLWAY AND OVERTOP RATING CURVES

BY KLB DATE 5-23-79

M.R.H. ✓

| RESERVOIR<br>WATER<br>SURFACE<br>ELEV. | HEAD ON<br>DROP INLET<br>SPILLWAY<br>(FT.)<br>H <sub>e</sub> | DROP<br>INLET<br>SPILLWAY<br>DISCHARGE<br>Q = 12.63√H <sub>e</sub> | EMERGENCY<br>SPILLWAY<br>DISCHARGE<br>(CFS) | OVERTOP<br>DISCHARGE<br>(CFS) | COMBINED<br>DISCHARGE<br>(CFS) |
|----------------------------------------|--------------------------------------------------------------|--------------------------------------------------------------------|---------------------------------------------|-------------------------------|--------------------------------|
| 814                                    | 49                                                           | -                                                                  | -                                           | -                             | 0                              |
| 814.5                                  | 49.5                                                         | *10.10                                                             | -                                           | -                             | 10.                            |
| 815                                    | 50                                                           | *28.6                                                              | -                                           | -                             | 28.                            |
| 816                                    | 51                                                           | *80.77                                                             | -                                           | -                             | 81.                            |
| 817                                    | 52                                                           | 91.08                                                              | -                                           | -                             | 91.1                           |
| 819.6                                  | 54.6                                                         | 93.33                                                              | 0                                           | -                             | 93.                            |
| 820.85                                 | 55.85                                                        | 94.39                                                              | 104.49                                      | -                             | 199                            |
| 821.37                                 | 56.37                                                        | 94.83                                                              | 251.14                                      | 294.72                        | 641                            |
| 822.99                                 | 57.99                                                        | 96.18                                                              | 1004.83                                     | 3580.78                       | 4682.                          |
| 824.49                                 | 59.49                                                        | 97.41                                                              | 1955.3                                      | 8316.4                        | 10,369.                        |

\* WEIR FLOW CONTROLS.

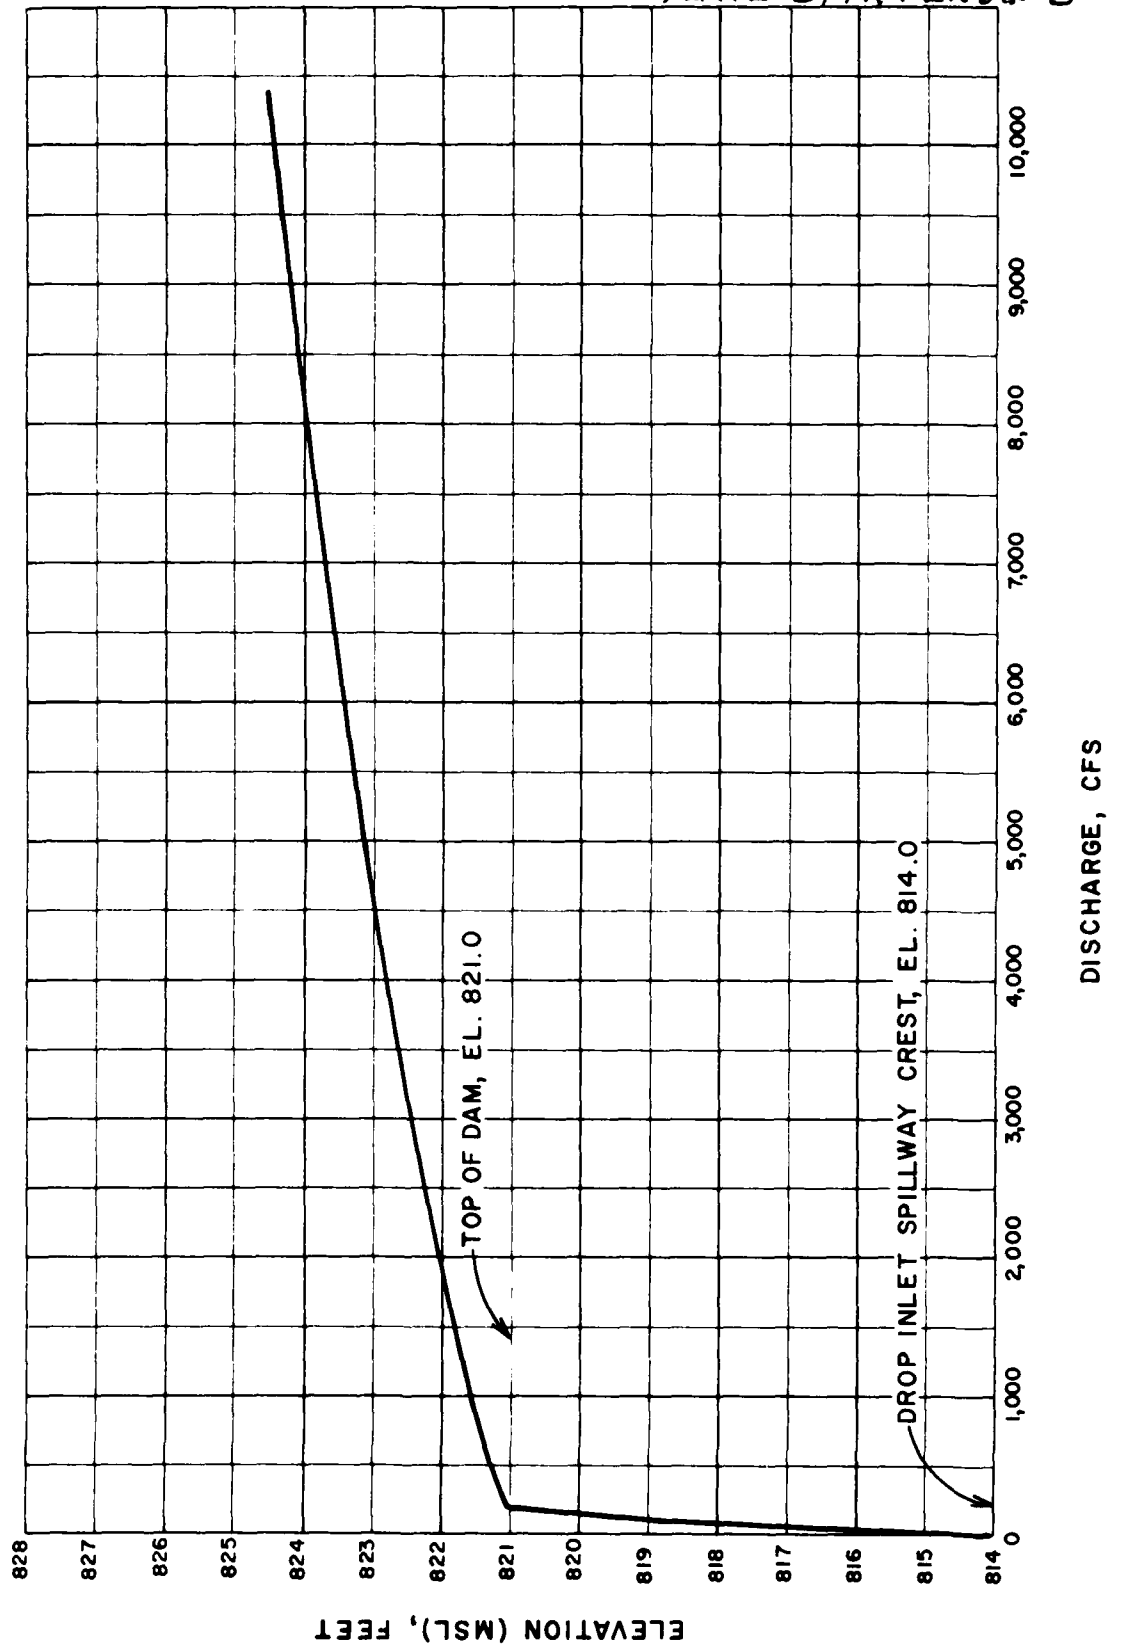

WOODRIDGE LAKE DAM (MO. 11005)  
SPILLWAY & OVERTOP RATING CURVE

Dam Safety Inspection - Missouri

SHEET NO. 1 OF

Woodridge Lake Dam - #11005


JOB NO. 1340

Reservoir Area Capacity

BY M.R.H. DATE 5-22-79

WOODRIDGE LAKE DAMReservoir Area Capacity

| Elev.<br>M.S.L.<br>(Ft.) | Reservoir<br>Surface<br>Area<br>(Acres) | Incremental<br>Volume<br>(Ac.-ft.) | Total<br>Volume<br>(Ac.-ft.) | Remarks                           |
|--------------------------|-----------------------------------------|------------------------------------|------------------------------|-----------------------------------|
| 765                      | 0                                       | -                                  | 0                            | Est. Streambed @<br>Center of Dam |
| 780                      | 6.4                                     | 32                                 | 32                           | Area measured on U.S.G.S.<br>map. |
| 800                      | 15.6                                    | 213                                | 245                          | Area measured on U.S.G.S.<br>map. |
| 814                      | 26                                      | 288                                | 533                          | Service Spillway El.<br>(Assumed) |
| 819.6                    | 31.7                                    | 161                                | 694                          | Emergency Spillway Crest          |
| 820                      | 32                                      | 13                                 | 707                          | Area measured on U.S.G.S.<br>map. |
| 821                      | 35                                      | 23                                 | 740                          | Top of Dam                        |
| 840                      | 66                                      | 944                                | 1684                         | Area measured on U.S.G.S.<br>map. |

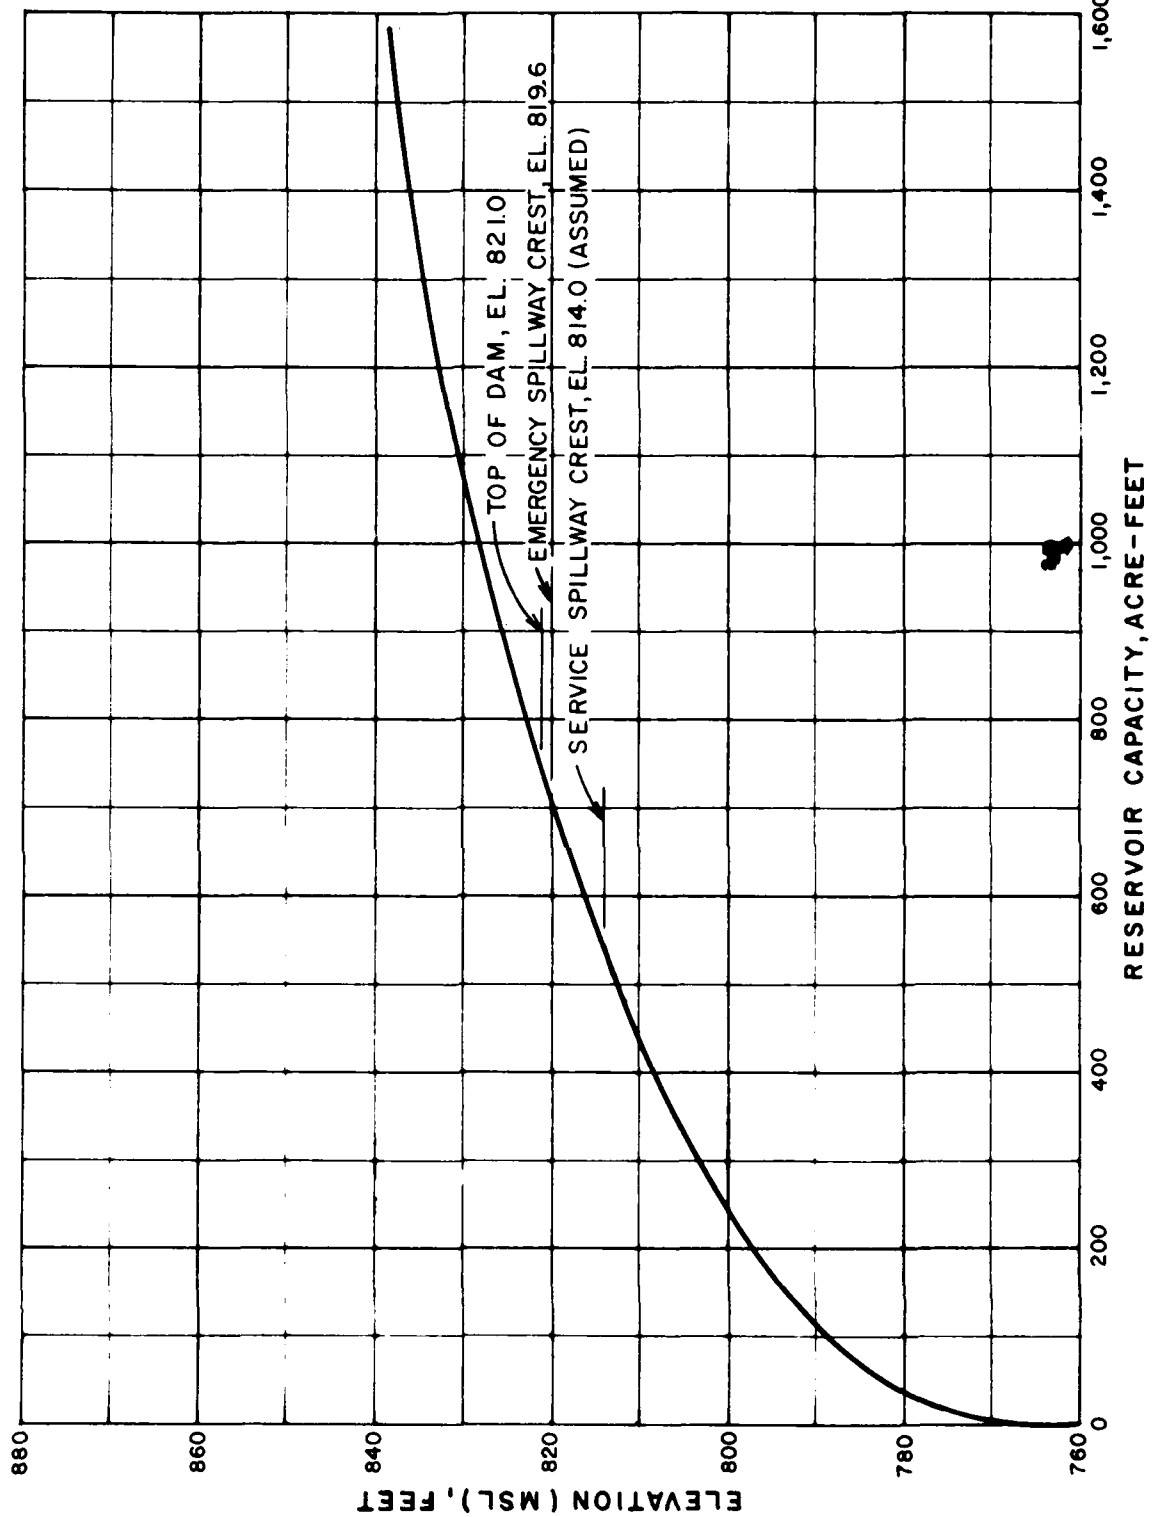

WOODRIDGE LAKE DAM (MO. 11005)  
RESERVOIR CAPACITY CURVE

DAM SAFETY INSPECTION / MISSOURI

SHEET NO. 1 OF

DAM # MO. 11005

JOB NO. 1240-001

PROBABLE MAXIMUM PRECIPITATION

BY MAS DATE 5/22/75

DAM NO. MO. 11005

DETERMINATION OF PMP

1. Determine drainage area of the basin

D.A. = 420 ACRES

2. Determine PMP Index Rainfall (For D.A. = 200 sq. mi.
- 
- 24 hrs. duration)


Location of centroid of basin

Long. =  $91^{\circ}10'9''$ , Lat. =  $38^{\circ}47'25'' \Rightarrow \text{PMP} = 24.0$  (From Fig. 1  
HMR 23)

3. Determine basin rainfall in terms of percentage of PMP Index Rainfall for various durations.

Location: Long. =  $91^{\circ}10'9''$ , Lat. =  $38^{\circ}47'25''$   
 $\Rightarrow$  Zone 7

| Duration<br>(Hrs.) | Percent<br>of Index<br>Rainfall<br>(%) | Total<br>Rainfall<br>(Inches) | Rainfall<br>Increment<br>(Inches) | Duration<br>of Increment<br>(Hrs.) |
|--------------------|----------------------------------------|-------------------------------|-----------------------------------|------------------------------------|
| 6                  | 100                                    | 24                            | 24                                | 6                                  |
| 12                 | 120                                    | 28.8                          | 4.8                               | 6                                  |
| 24                 | 130                                    | 31.2                          | 2.4                               | 12                                 |

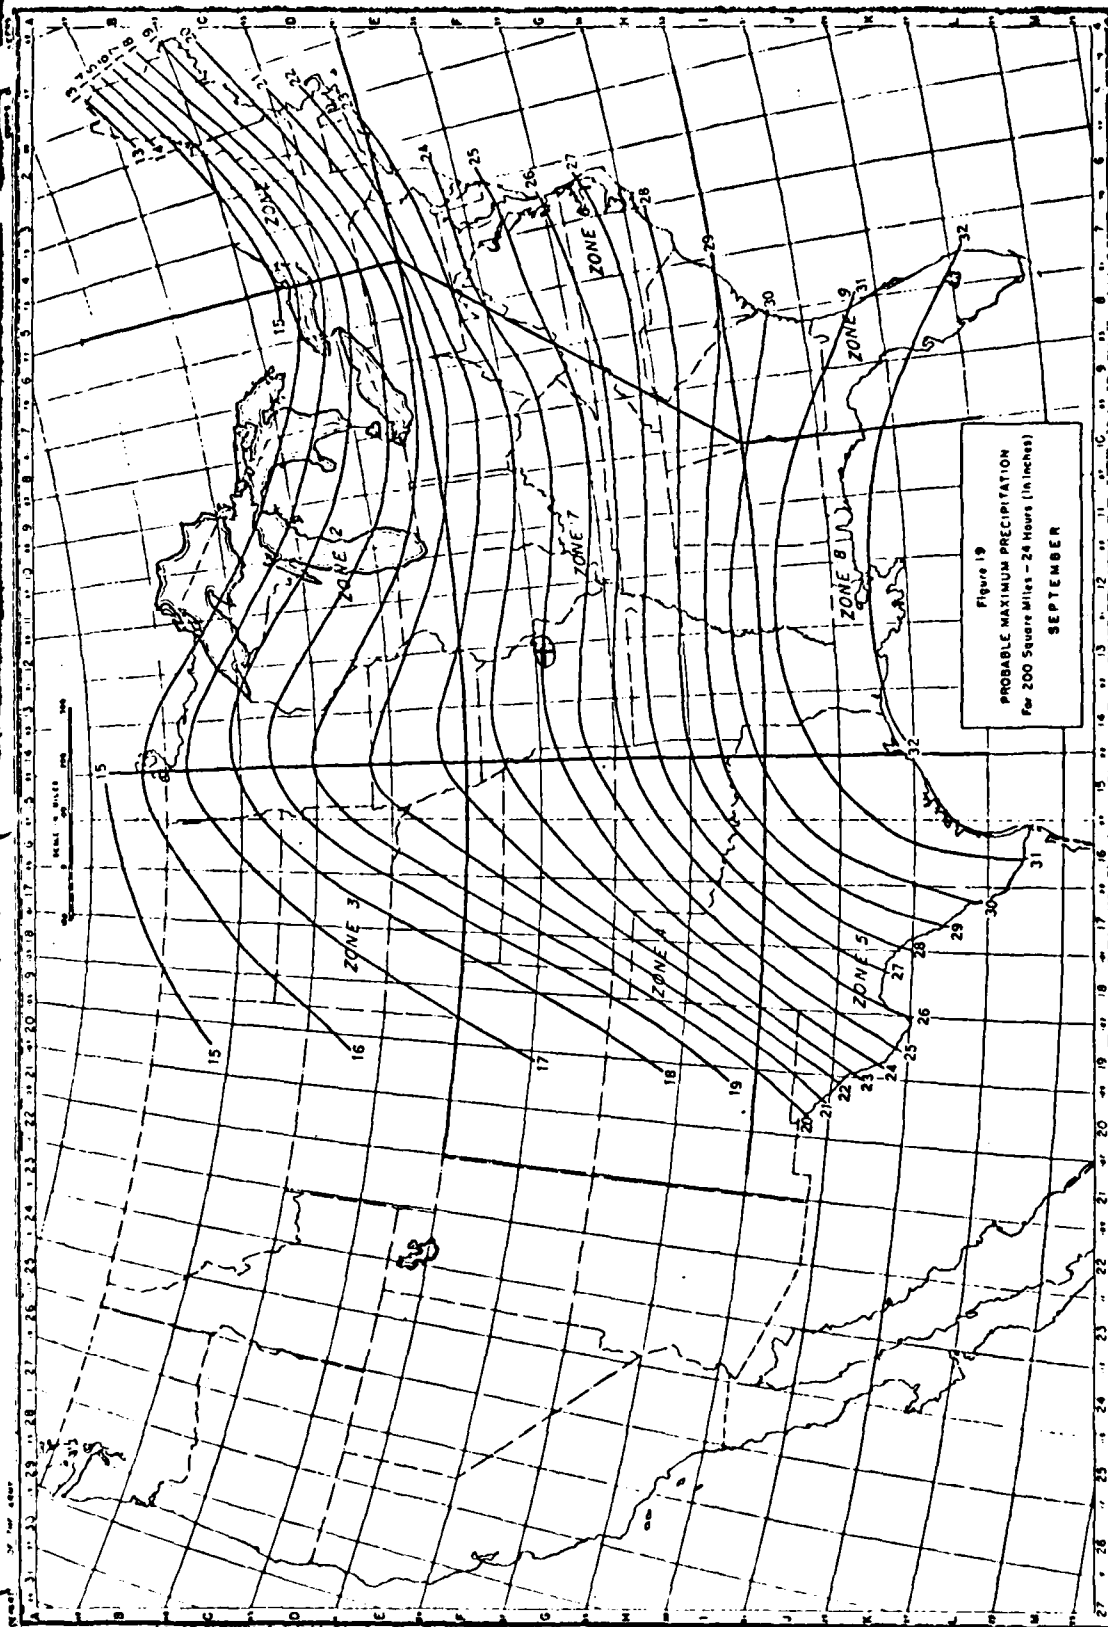

WOODRIDGE LAKE DAM (MO. 11005)

LOCATION OF CENTER  
 OF WATERSHED:

LAT. 38° 47' 25" LONG. 91° 10' 09"

PMP FOR 11 S.S.M. - 24 HRS

= 24"

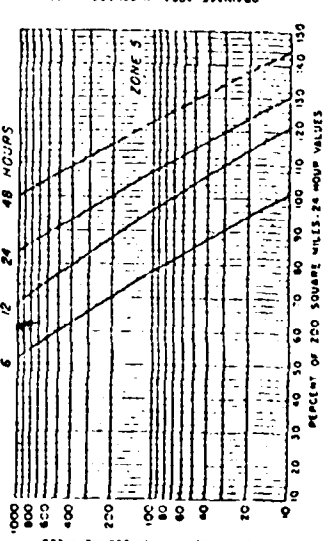
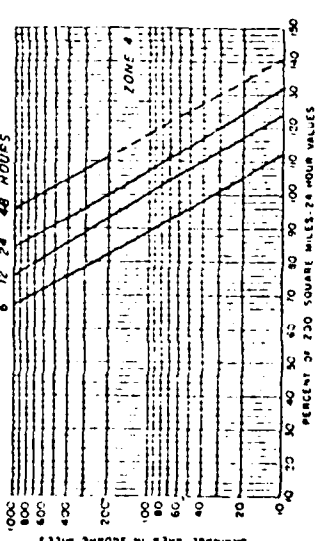
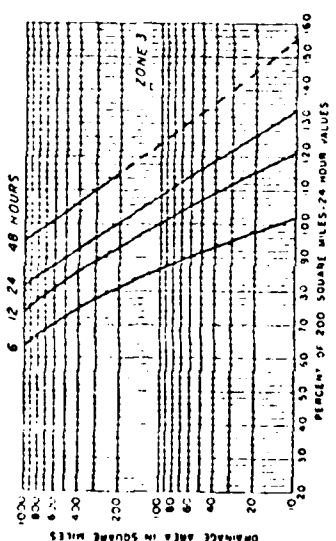
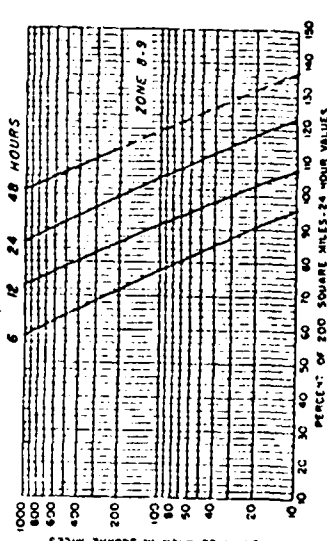
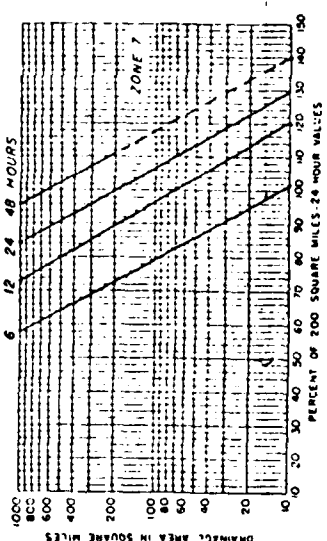
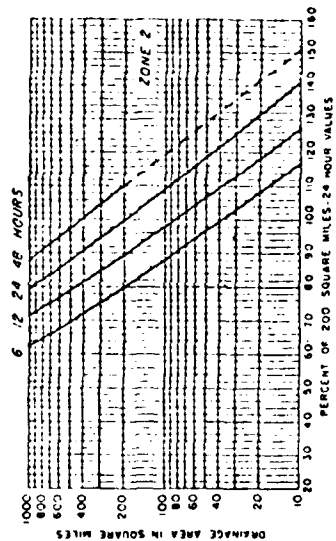
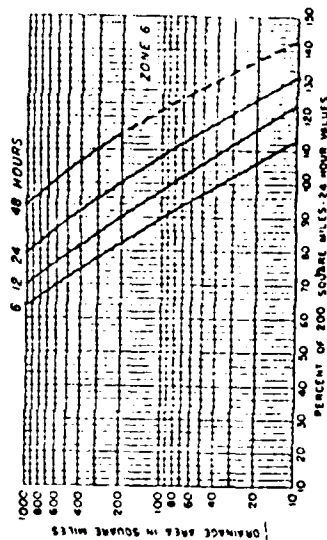
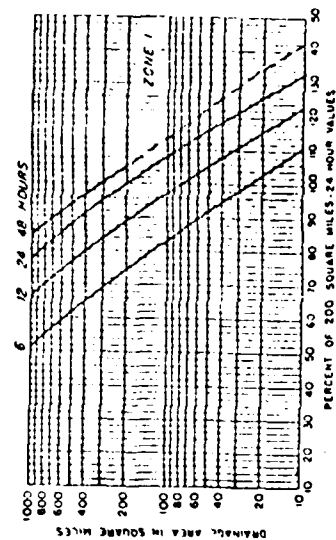


FIGURE 2  
SEASONAL VARIATION  
DEPTH-AREA-DURATION RELATIONSHIPS  
Percentage to be applied to 200 square miles  
24 hour probable maximum precipitation values  
for: THE-ALL SEASON ENVELOPE

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 1 OF

DAM # 11005

JOB NO. 1240-001-1

UNIT HYDROGRAPH PARAMETERS

BY KLB DATE 5-30-7

1. DRAINAGE AREA,  $A = 420 A_c = 0.66 \text{ SQ. mi.}$ 2. LENGTH OF STREAM =  $(1.95'' \times 2000' = 3900) = 0.74 \text{ mi.}$ 3. ELEVATION AT DRAINAGE DIVIDE ALONG THE LONGEST  
STREAM,  $H_1 = 930'$ 4. RESERVOIR ELEVATION AT SPILLWAY CREST,  $H_2 = 814'$ 5. DIFFERENCE IN ELEVATION,  $\Delta H = 930' - 814' = 116'$ 6. AVERAGE SLOPE OF STREAM =  $\frac{\Delta H}{L} = \frac{116}{3900} = 2.97\%$ 

7. TIME OF CONCENTRATION:

a) BY KIRPICH FORMULA:

$$T_c = \left( \frac{11.9 \times L^3}{\Delta H} \right)^{0.385} = \left( \frac{11.9 \times 0.74^3}{116} \right)^{0.385} = 0.29 \text{ HR}$$

b) BY VELOCITY ESTIMATE.

SLOPE = 2.9%  $\Rightarrow$  AVG. VELOCITY = 3 FPS.

$$\therefore T_c = \frac{0.74 \times 5280}{3 \times 60 \times 60} = 0.36 \text{ HR.}$$

USE  $T_c = 0.30 \text{ HR}$ 8. LAG TIME =  $L_t = 0.6 \times 0.30 = 0.18 \text{ HR}$ 9. UNIT DURATION  $D \leq \frac{L_t}{3} = \frac{0.18}{3} = 0.06 < 0.083$ USE  $D = 0.083 \text{ HR} = 5 \text{ min.}$ 10. TIME TO PEAK,  $T_p = \frac{D}{2} + L_t = \frac{0.083}{2} + 0.18$ 

$$T_p = 0.22 \text{ HR}$$

11. PEAK DISCHARGE,  $q_p = \frac{484 \cdot A}{T_p} = \frac{484 \cdot (0.66)}{0.22}$ 

$$q_p = 1452 \text{ CFS.}$$

DAM SAFETY INSPECTION/MISSOURI

SHEET NO. 1 OF

DAM # MO. 11005

JOB NO. 1240-001

DETERMINATION OF SOIL GROUP &amp; CURVE NUMBER

BY MAS

DATE 5/31/79

MISSOURI DAM # MO 11005

DETERMINATION OF HYDROLOGIC SOIL GROUP &amp; SCS CURVE NUMBER

1. Watershed soils consist of B, C & D group soils. Soil group D is predominant. Assume soil group 'D' for the entire watershed.

2. Most of the watershed is wooded and covered with grass. Assume 'Fair' condition for infiltration purpose

Thus  $CN = 79$  for group 'D' soil & AMC-II

$\Rightarrow \underline{CN = 91 \text{ for AMC-III}}$

HEC1DB INPUT DATA

[illegible]

INFLOW PMF AND ONE-HALF PMF HYDROGRAPHS

.....  
 FLOOD HYDROGRAPH PACKAGE (HEC-1)  
 DAM SAFETY VERSION JULY 1978  
 LAST MODIFICATION 26 FEB 79  
 .....

901 DATE: 79/05/12  
 TIME: 09.17.09.

DAM SAFETY INSPECTION - MISSOURI  
 MOORIDGE LAKE DAM (11005)  
 PMF AND % PERCENT PMF DETERMINATION AND ROUTING

| JOB SPECIFICATION |     |      |       |     |       |       |      |      |       |
|-------------------|-----|------|-------|-----|-------|-------|------|------|-------|
| AG                | NHR | NMIC | IDAY  | IMR | IMIN  | NETRC | JPLT | IPRT | NSTAN |
| 300               | 0   | 5    | 0     | 0   | 0     | 0     | 0    | 0    | 0     |
|                   |     |      | JUPER | NMT | LROPT | TRACC |      |      |       |
|                   |     |      | 5     | 0   | 0     | 0     |      |      |       |

MULTI-PHASE ANALYSES TO BE PERFORMED

NPLAN= 1 NRTIO= 2 LPTIME= 1

RRTIO= 1.00

SUB-AREA RUNOFF COMPUTATION

INPUT INDEX PRECIPITATION AND RATIOS, INPUT FOR UNIT HYDROGRAPH PARAMETERS

| ISTAO | ICOMP | IECON | ITIDE | JPLT | JFRT | INME | ISTAGE | IAUTO |
|-------|-------|-------|-------|------|------|------|--------|-------|
| 11005 | 0     | 0     | 0     | 0    | 0    | 0    | 0      | 0     |

HYDROGRAPH DATA

| INVDG | TUNG | TAREA | SHAP | TRSDA | TRSPC | RATIO | ISNON | ISAMP | LOCAL |
|-------|------|-------|------|-------|-------|-------|-------|-------|-------|
| 1     | 2    | .66   | 0.00 | .66   | 1.00  | 3.000 |       |       |       |

PRECIP DATA

| SPFE | PMS   | P6     | R12    | R24    | P48  | P72  | R96  |
|------|-------|--------|--------|--------|------|------|------|
| 0.00 | 24.00 | 100.00 | 120.00 | 130.00 | 0.00 | 0.00 | 0.00 |

LOSS DATA

| LROPT | STRKR | DLTR | RTIOL | CRAIN | STKRS | RTIOK | STRFL | CNSTL  | ALSHK | PTIMP |
|-------|-------|------|-------|-------|-------|-------|-------|--------|-------|-------|
| 0     | 0.00  | 0.00 | 1.00  | 0.00  | 0.00  | 1.00  | -1.00 | -01.00 | 0.00  | 0.00  |

CURVE NO = -91.00 WETNESS = -1.00 EFFECT CN = 91.00

UNIT HYDROGRAPH DATA

TC= 0.00 LAGE = .1R

RECESSION DATA

STRK2= 0.00 OR-SH= 0.00 RTIOK= 1.00

UNIT HYDROGRAPH IS END OF PERIOD ORIGINATES. TC= 0.00 HOURS, LAGE = .1R VOL= 1.00  
 604. 1289. 1398. 973. 991. 973. 987. 78. 43. 23.

| NO. DA | HR. MN | PERIOD | PAIN | EXCS | LOSS | COMP 2 | END-OF-PERIOD FLOW | NO. DA | HR. MN | PERIOD | HAIV | EXCS | LOSS | COMP 0 |
|--------|--------|--------|------|------|------|--------|--------------------|--------|--------|--------|------|------|------|--------|
| 1.01   | 1.01   | 1      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 1      | .00  | .00  | .00  | 981.   |
| 1.01   | 1.01   | 2      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 2      | .00  | .00  | .00  | 993.   |
| 1.01   | 1.01   | 3      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 3      | .00  | .00  | .00  | 999.   |
| 1.01   | 1.01   | 4      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 4      | .00  | .00  | .00  | 1003.  |
| 1.01   | 1.01   | 5      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 5      | .00  | .00  | .00  | 1005.  |
| 1.01   | 1.01   | 6      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 6      | .00  | .00  | .00  | 1007.  |
| 1.01   | 1.01   | 7      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 7      | .00  | .00  | .00  | 1024.  |
| 1.01   | 1.01   | 8      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 8      | .00  | .00  | .00  | 1074.  |
| 1.01   | 1.01   | 9      | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 9      | .00  | .00  | .00  | 1130.  |
| 1.01   | 1.01   | 10     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 10     | .00  | .00  | .00  | 1149.  |
| 1.01   | 1.01   | 11     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 11     | .00  | .00  | .00  | 1189.  |
| 1.01   | 1.01   | 12     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 12     | .00  | .00  | .00  | 1201.  |
| 1.01   | 1.01   | 13     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 13     | .00  | .00  | .00  | 1207.  |
| 1.01   | 1.01   | 14     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 14     | .00  | .00  | .00  | 1211.  |
| 1.01   | 1.01   | 15     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 15     | .00  | .00  | .00  | 1213.  |
| 1.01   | 1.01   | 16     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 16     | .00  | .00  | .00  | 1215.  |
| 1.01   | 1.01   | 17     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 17     | .00  | .00  | .00  | 1216.  |
| 1.01   | 1.01   | 18     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 18     | .00  | .00  | .00  | 1216.  |
| 1.01   | 1.01   | 19     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 19     | .00  | .00  | .00  | 1241.  |
| 1.01   | 1.01   | 20     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 20     | .00  | .00  | .00  | 1316.  |
| 1.01   | 1.01   | 21     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 21     | .00  | .00  | .00  | 1400.  |
| 1.01   | 1.01   | 22     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 22     | .00  | .00  | .00  | 1458.  |
| 1.01   | 1.01   | 23     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 23     | .00  | .00  | .00  | 1488.  |
| 1.01   | 1.01   | 24     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 24     | .00  | .00  | .00  | 1505.  |
| 1.01   | 1.01   | 25     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 25     | .00  | .00  | .00  | 1514.  |
| 1.01   | 1.01   | 26     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 26     | .00  | .00  | .00  | 1519.  |
| 1.01   | 1.01   | 27     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 27     | .00  | .00  | .00  | 1522.  |
| 1.01   | 1.01   | 28     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 28     | .00  | .00  | .00  | 1523.  |
| 1.01   | 1.01   | 29     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 29     | .00  | .00  | .00  | 1525.  |
| 1.01   | 1.01   | 30     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 30     | .00  | .00  | .00  | 1525.  |
| 1.01   | 1.01   | 31     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 31     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 32     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 32     | .00  | .00  | .00  | 1488.  |
| 1.01   | 1.01   | 33     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 33     | .00  | .00  | .00  | 1470.  |
| 1.01   | 1.01   | 34     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 34     | .00  | .00  | .00  | 1488.  |
| 1.01   | 1.01   | 35     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 35     | .00  | .00  | .00  | 2068.  |
| 1.01   | 1.01   | 36     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 36     | .00  | .00  | .00  | 2862.  |
| 1.01   | 1.01   | 37     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 37     | .00  | .00  | .00  | 4748.  |
| 1.01   | 1.01   | 38     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 38     | .00  | .00  | .00  | 4831.  |
| 1.01   | 1.01   | 39     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 39     | .00  | .00  | .00  | 7143.  |
| 1.01   | 1.01   | 40     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 40     | .00  | .00  | .00  | 5941.  |
| 1.01   | 1.01   | 41     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 41     | .00  | .00  | .00  | 4536.  |
| 1.01   | 1.01   | 42     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 42     | .00  | .00  | .00  | 3470.  |
| 1.01   | 1.01   | 43     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 43     | .00  | .00  | .00  | 3740.  |
| 1.01   | 1.01   | 44     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 44     | .00  | .00  | .00  | 2267.  |
| 1.01   | 1.01   | 45     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 45     | .00  | .00  | .00  | 1867.  |
| 1.01   | 1.01   | 46     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 46     | .00  | .00  | .00  | 1468.  |
| 1.01   | 1.01   | 47     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 47     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 48     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 48     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 49     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 49     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 50     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 50     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 51     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 51     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 52     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 52     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 53     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 53     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 54     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 54     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 55     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 55     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 56     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 56     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 57     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 57     | .00  | .00  | .00  | 1478.  |
| 1.01   | 1.01   | 58     | .01  | .00  | .01  | 0      | 1.01 1.01          | 1.01   | 1.01   | 58     | .00  | .00  | .00  | 1478.  |

|      |       |     |     |     |     |      |      |       |     |     |     |     |       |
|------|-------|-----|-----|-----|-----|------|------|-------|-----|-----|-----|-----|-------|
| 1.01 | 8.45  | 57  | .01 | .01 | .01 | 39.  | 1.01 | 17.15 | 207 | .22 | .22 | .00 | 12.51 |
| 1.01 | 8.50  | 58  | .01 | .01 | .01 | 39.  | 1.01 | 17.20 | 208 | .22 | .22 | .00 | 11.87 |
| 1.01 | 8.55  | 59  | .01 | .01 | .01 | 40.  | 1.01 | 17.25 | 209 | .22 | .22 | .00 | 11.88 |
| 1.01 | 8.60  | 60  | .01 | .01 | .01 | 40.  | 1.01 | 17.30 | 210 | .22 | .22 | .00 | 11.91 |
| 1.01 | 8.65  | 61  | .01 | .01 | .01 | 41.  | 1.01 | 17.35 | 211 | .22 | .22 | .00 | 11.93 |
| 1.01 | 8.70  | 62  | .01 | .01 | .01 | 41.  | 1.01 | 17.40 | 212 | .22 | .22 | .00 | 11.98 |
| 1.01 | 8.75  | 63  | .01 | .01 | .01 | 42.  | 1.01 | 17.45 | 213 | .22 | .22 | .00 | 11.98 |
| 1.01 | 8.80  | 64  | .01 | .01 | .01 | 42.  | 1.01 | 17.50 | 214 | .22 | .22 | .00 | 11.94 |
| 1.01 | 8.85  | 65  | .01 | .01 | .01 | 43.  | 1.01 | 17.55 | 215 | .22 | .22 | .00 | 11.94 |
| 1.01 | 8.90  | 66  | .01 | .01 | .01 | 43.  | 1.01 | 18.00 | 216 | .22 | .22 | .00 | 11.94 |
| 1.01 | 8.95  | 67  | .01 | .01 | .01 | 43.  | 1.01 | 18.05 | 217 | .22 | .22 | .00 | 11.94 |
| 1.01 | 9.00  | 68  | .01 | .01 | .01 | 44.  | 1.01 | 18.10 | 218 | .22 | .22 | .00 | 11.94 |
| 1.01 | 9.05  | 69  | .01 | .01 | .01 | 44.  | 1.01 | 18.15 | 219 | .22 | .22 | .00 | 511.  |
| 1.01 | 9.10  | 70  | .01 | .01 | .01 | 45.  | 1.01 | 18.20 | 220 | .22 | .22 | .00 | 517.  |
| 1.01 | 9.15  | 71  | .01 | .01 | .01 | 45.  | 1.01 | 18.25 | 221 | .22 | .22 | .00 | 219.  |
| 1.01 | 9.20  | 72  | .01 | .01 | .01 | 45.  | 1.01 | 18.30 | 222 | .22 | .22 | .00 | 165.  |
| 1.01 | 9.25  | 73  | .01 | .01 | .01 | 61.  | 1.01 | 18.35 | 223 | .22 | .22 | .00 | 158.  |
| 1.01 | 9.30  | 74  | .01 | .01 | .01 | 168. | 1.01 | 18.40 | 224 | .22 | .22 | .00 | 158.  |
| 1.01 | 9.35  | 75  | .01 | .01 | .01 | 163. | 1.01 | 18.45 | 225 | .22 | .22 | .00 | 111.  |
| 1.01 | 9.40  | 76  | .01 | .01 | .01 | 263. | 1.01 | 18.50 | 226 | .22 | .22 | .00 | 166.  |
| 1.01 | 9.45  | 77  | .01 | .01 | .01 | 226. | 1.01 | 18.55 | 227 | .22 | .22 | .00 | 164.  |
| 1.01 | 9.50  | 78  | .01 | .01 | .01 | 242. | 1.01 | 19.00 | 228 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.55  | 79  | .01 | .01 | .01 | 252. | 1.01 | 19.05 | 229 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.60  | 80  | .01 | .01 | .01 | 260. | 1.01 | 19.10 | 230 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.65  | 81  | .01 | .01 | .01 | 267. | 1.01 | 19.15 | 231 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.70  | 82  | .01 | .01 | .01 | 272. | 1.01 | 19.20 | 232 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.75  | 83  | .01 | .01 | .01 | 276. | 1.01 | 19.25 | 233 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.80  | 84  | .01 | .01 | .01 | 280. | 1.01 | 19.30 | 234 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.85  | 85  | .01 | .01 | .01 | 283. | 1.01 | 19.35 | 235 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.90  | 86  | .01 | .01 | .01 | 286. | 1.01 | 19.40 | 236 | .22 | .22 | .00 | 162.  |
| 1.01 | 9.95  | 87  | .01 | .01 | .01 | 289. | 1.01 | 19.45 | 237 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.00 | 88  | .01 | .01 | .01 | 292. | 1.01 | 19.50 | 238 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.05 | 89  | .01 | .01 | .01 | 294. | 1.01 | 19.55 | 239 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.10 | 90  | .01 | .01 | .01 | 296. | 1.01 | 20.00 | 240 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.15 | 91  | .01 | .01 | .01 | 298. | 1.01 | 20.05 | 241 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.20 | 92  | .01 | .01 | .01 | 300. | 1.01 | 20.10 | 242 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.25 | 93  | .01 | .01 | .01 | 302. | 1.01 | 20.15 | 243 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.30 | 94  | .01 | .01 | .01 | 304. | 1.01 | 20.20 | 244 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.35 | 95  | .01 | .01 | .01 | 305. | 1.01 | 20.25 | 245 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.40 | 96  | .01 | .01 | .01 | 307. | 1.01 | 20.30 | 246 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.45 | 97  | .01 | .01 | .01 | 309. | 1.01 | 20.35 | 247 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.50 | 98  | .01 | .01 | .01 | 310. | 1.01 | 20.40 | 248 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.55 | 99  | .01 | .01 | .01 | 311. | 1.01 | 20.45 | 249 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.60 | 100 | .01 | .01 | .01 | 312. | 1.01 | 20.50 | 250 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.65 | 101 | .01 | .01 | .01 | 313. | 1.01 | 20.55 | 251 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.70 | 102 | .01 | .01 | .01 | 314. | 1.01 | 21.00 | 252 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.75 | 103 | .01 | .01 | .01 | 315. | 1.01 | 21.05 | 253 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.80 | 104 | .01 | .01 | .01 | 316. | 1.01 | 21.10 | 254 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.85 | 105 | .01 | .01 | .01 | 317. | 1.01 | 21.15 | 255 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.90 | 106 | .01 | .01 | .01 | 318. | 1.01 | 21.20 | 256 | .22 | .22 | .00 | 162.  |
| 1.01 | 10.95 | 107 | .01 | .01 | .01 | 319. | 1.01 | 21.25 | 257 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.00 | 108 | .01 | .01 | .01 | 320. | 1.01 | 21.30 | 258 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.05 | 109 | .01 | .01 | .01 | 321. | 1.01 | 21.35 | 259 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.10 | 110 | .01 | .01 | .01 | 321. | 1.01 | 21.40 | 260 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.15 | 111 | .01 | .01 | .01 | 321. | 1.01 | 21.45 | 261 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.20 | 112 | .01 | .01 | .01 | 322. | 1.01 | 21.50 | 262 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.25 | 113 | .01 | .01 | .01 | 322. | 1.01 | 21.55 | 263 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.30 | 114 | .01 | .01 | .01 | 323. | 1.01 | 22.00 | 264 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.35 | 115 | .01 | .01 | .01 | 323. | 1.01 | 22.05 | 265 | .22 | .22 | .00 | 162.  |
| 1.01 | 11.40 | 116 | .01 | .01 | .01 | 324. | 1.01 | 22.10 | 266 | .22 | .22 | .00 | 162.  |





100

## ROUTE HYDROGRAPH THROUGH WOODRIDGE LAKE CAN

END-OF-PERIOD HYDROGRAPH COORDINATES

•

22

69

27.

24

SUMMARY OF PMF AND ONE-HALF PMF FLOOD ROUTING

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO I. ONDMIC COMPUTATIONS  
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)  
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

| OPERATION     | STATION | AREA  | RATIOS APPLIED TO FLOWS |                   |
|---------------|---------|-------|-------------------------|-------------------|
|               |         |       | PLAN RATIO              | RATIO 2           |
|               |         |       | 1.00                    | .50               |
| HYDROGRAPH AT | 11005   | .66   | 1                       | 7143.             |
|               | (       | 1.71) | (                       | 202.75)( 101.13)( |
| ROUTED TO     | 11005   | .66   | 1                       | 5255.             |
|               | (       | 1.71) | (                       | 148.91)( 65.44)(  |

# SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1

.....

ELEVATION  
STORAGE  
OUTFLOW

INITIAL VALUE  
414.70  
533.  
0.

SPILLWAY CREST  
614.00  
533.  
0.

TOP OF DAM  
821.00  
740.  
203.

RATIO  
OF  
PWF

MAXIMUM  
RESERVOIR  
W.S. FLOW

MAXIMUM  
DEPTH  
OVER DAM

MAXIMUM  
STORAGE  
AC-FT

MAXIMUM  
OUTFLOW  
CFS

DURATION  
OVER TOP  
HOURS

TIME OF  
MAX OUTFLOW  
HOURS

TIME OF  
FAILURE  
HOURS

1.00

423.14  
822.00

2.14  
1.00

846.  
792.

5259.  
2325.

6.00  
3.42

17.83  
15.92

0.00  
0.00

PERCENT OF PMF FLOOD ROUTING  
EQUAL TO SPILLWAY CAPACITY



SUM 31.20 30.04 1.16 153465.  
( 792.31( 763.31( 25.31( 4345.64)

.....

.....

.....

.....

.....

# HYDROGRAPH ROUTING

## ROUTE HYDROGRAPH THROUGH WOODRIDGE LAKE DAM

ISTAG ICOMP IECOA ITAPE JPLY JPRY INAME ISTAGE IAUTG  
11005 1 0 0 0 0 0 0 0

### ROUTING DATA

QLOSS CLOSS AVS IPES ISAME IMPT IOMP LSTR  
0.0 0.000 0.00 1 1 0 0 0

VSIPS NATDL LAG ANSKK X TSA STORA ISPRAY  
1 0 0 0.000 0.000 0.000 0.000 -0.1

STAGE 814.00 814.50 815.00 816.00 817.00 818.00 821.00 821.37 822.99

824.49

FLOW 0.00 10.00 29.00 81.00 91.00 93.00 199.00 207.00 452.00

10369.00

CAPACITY= 0. 32. 243. 535. 694. 737. 740. 1424.

ELEVATION= 765. 780. 800. 814. 820. 821. 821. 821.

CREL SPALD CCOM EXPW FLEVL COJL CAREA EAPL  
814.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0

DAM DATA  
TOPEL 421.0 COTD 0.0 EXPD 0.0 DAMWID 1.

PEAK OUTFLOW IS 172. AT TIME 18.17 HOURS

PEAK OUTFLOW IS 188. AT TIME 18.17 HOURS

PEAK OUTFLOW IS 201. AT TIME 18.17 HOURS

PEAK OUTFLOW IS 242. AT TIME 19.08 HOURS

PEAK OUTFLOW IS 311. AT TIME 19.08 HOURS

PEAK OUTFLOW IS 344. AT TIME 17.50 HOURS

PEAK OUTFLOW IS 390. AT TIME 17.25 HOURS

PEAK OUTFLOW IS 426. AT TIME 17.17 HOURS

PEAK OUTFLOW IS 402. AF 114 17.00 HOURS

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-HAYD ECONOMIC COMPUTATIONS  
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)  
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

| OPERATION     | STATION   | AREA          | PLAN | RATIOS APPLIED TO FLOW |                  |                  |                  |                  |                  |                  |                  |                  |
|---------------|-----------|---------------|------|------------------------|------------------|------------------|------------------|------------------|------------------|------------------|------------------|------------------|
|               |           |               |      | RATIO 1                | RATIO 2          | RATIO 3          | RATIO 4          | RATIO 5          | RATIO 6          | RATIO 7          | RATIO 8          | RATIO 9          |
| HYDROGRAPH AT | 11005     | .66<br>(1.71) | 1    | 1786.<br>(45.50)       | 1507.<br>(39.05) | 1828.<br>(47.51) | 2000.<br>(51.65) | 2071.<br>(53.65) | 2103.<br>(54.63) | 2210.<br>(57.31) | 2286.<br>(59.23) | 2357.<br>(60.74) |
|               | ROUTED TO | .66<br>(1.71) | 1    | 172.<br>(4.47)         | 150.<br>(3.91)   | 201.<br>(5.18)   | 272.<br>(7.01)   | 311.<br>(7.93)   | 344.<br>(8.88)   | 390.<br>(10.04)  | 428.<br>(11.03)  | 462.<br>(11.99)  |

AD-A105 011

PRC CONSOER TOWNSEND INC ST LOUIS MO  
NATIONAL DAM SAFETY PROGRAM. WOODRIDGE LAKE DAM (MO 11005), MIS--ETC(U)  
SEP 79 W G SHIFRIN  
DACW43-79-C-0075

F/G 13/13

UNCLASSIFIED

NL

2 of 2  
AD-A  
105-011



END  
DATE  
FILMED  
10-81  
DTIC

| RATIO<br>OF<br>PMF | MAXIMUM<br>RESEALING<br>WATER-LEVEL | MAXIMUM<br>DEPTH<br>OVER DAM | MAXIMUM<br>STORAGE<br>AC-FT | MAXIMUM<br>OUTFLOW<br>CFS | DURATION<br>TO TOP<br>HOURS | TIME OF<br>MAX OUTFLOW<br>HOURS | TIME OF<br>FAILURE<br>HOURS |
|--------------------|-------------------------------------|------------------------------|-----------------------------|---------------------------|-----------------------------|---------------------------------|-----------------------------|
| .25                | 820.53                              | 0.30                         | 725.                        | 172.                      | 0.00                        | 13.17                           | 0.00                        |
| .26                | 870.72                              | 0.00                         | 731.                        | 188.                      | 0.00                        | 1.67                            | 0.00                        |
| .27                | 820.91                              | 0.03                         | 731.                        | 231.                      | 0.00                        | 3.30                            | 0.00                        |
| .28                | 821.05                              | .05                          | 742.                        | 262.                      | .75                         | 1.08                            | 0.00                        |
| .29                | 821.07                              | .02                          | 755.                        | 311.                      | 1.42                        | 16.0P                           | 0.00                        |
| .30                | 821.12                              | .02                          | 766.                        | 348.                      | 1.43                        | 17.50                           | 0.00                        |
| .31                | 821.16                              | .15                          | 784.                        | 390.                      | 2.25                        | 16.25                           | 0.00                        |
| .32                | 821.19                              | .19                          | 789.                        | 424.                      | 2.42                        | 17.17                           | 0.00                        |
| .33                | 821.22                              | .22                          | 791.                        | 462.                      | 2.58                        | 17.08                           | 0.00                        |

DATE  
FILMED  
-8